

General Information

Date & Time: 08, Jul, 2026 14:56

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	114,853
Registration No.	NIJ3650	Chassis No.	PA1B18F31P4204013
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



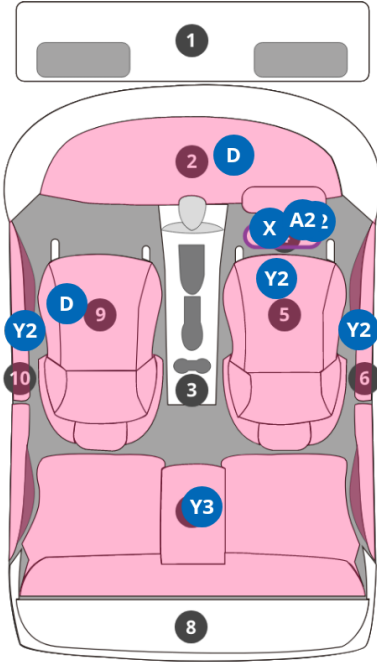
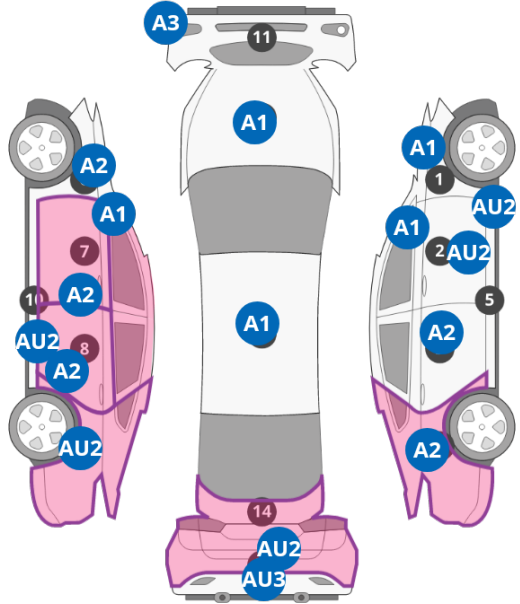
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	105	113	105
2	Boot Lid	236.3	201	348	160
3	Roof	96.1	102	95	89/98
4	Left Front Fender	103.3	106	104	100
5	Left Front Door	136.3	135	127	147
6	Center Panel Left				
7	Left Rear Door	529.0	1,208	191	188
8	Left Back Panel	683.3	565	474	1,011
9	Right Front Fender	104.0	101	103	108
10	Right Front Door	105.6	106	108	103
11	Center Panel Right				
12	Right Rear Door	105.1	99	101	116
13	Right Back Panel	139.3	143	136	139

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / Carpet - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/no spare key/traces of adhesive on front windshield and rear view mirror/plate light issue/abnormal vibration/scratches on taillight cover/hairline scratches on the body