

General Information

Date & Time: 30, Jun, 2026 21:34

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	14,506
Registration No.	FAR9942	Chassis No.	MHKAA1BC6RJ022161
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



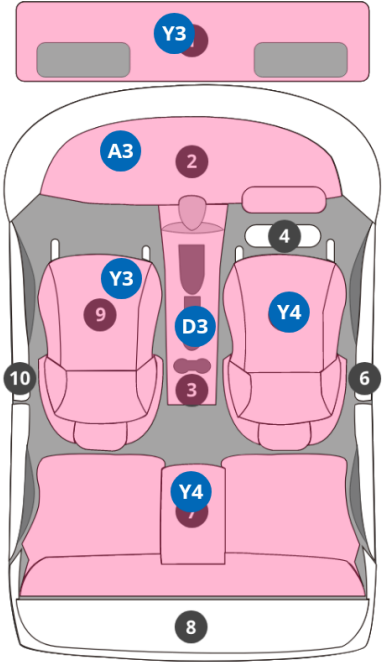
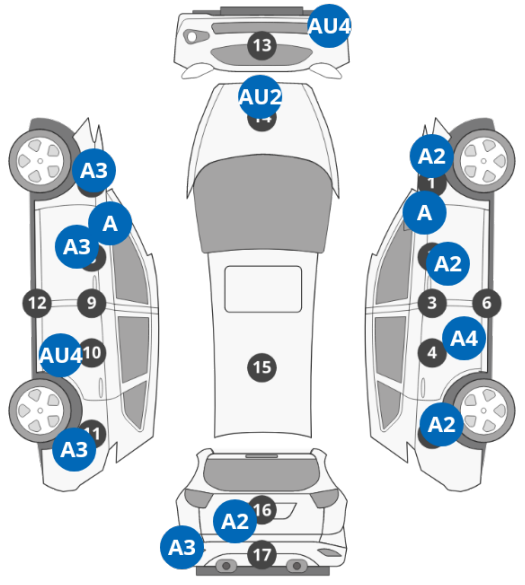
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.2	93	92	86
2	Boot Lid	72.6	70	78	70
3	Roof	68.8	70	68	72/65
4	Left Front Fender	78.8	72	90	75
5	Left Front Door	93.3	94	93	93
6	Center Panel Left				
7	Left Rear Door	87.4	93	89	80
8	Left Back Panel	83.9	91	82	79
9	Right Front Fender	75.0	77	77	71
10	Right Front Door	90.3	96	91	85
11	Center Panel Right				
12	Right Rear Door	85.8	77	88	92
13	Right Back Panel	79.4	81	79	78

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Instrument Panel - Worn, Scratch, Cut, Crack - Medium / Console, Switches, Vents - Loose, Deformed - Medium / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / Ceiling - Grime - Medium / Rear Seat - Grime - Large	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch, Peeled - Yes / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / (L) Mirror - Scratch, Peeled - Yes
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes

Inspector Notes

with Ito plate, with warranty booklet, with jack, with spare tire, with tools, scratch on left head light, radio / display issue, hairline scratches in the body