

General Information

Date & Time: 26, Feb, 2025 13:39

Make	Suzuki	Model	Carry
YOM	2023	Mileage	25,068
Registration No.	NFA9004	Chassis No.	MHYDC61T0PJ215048
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



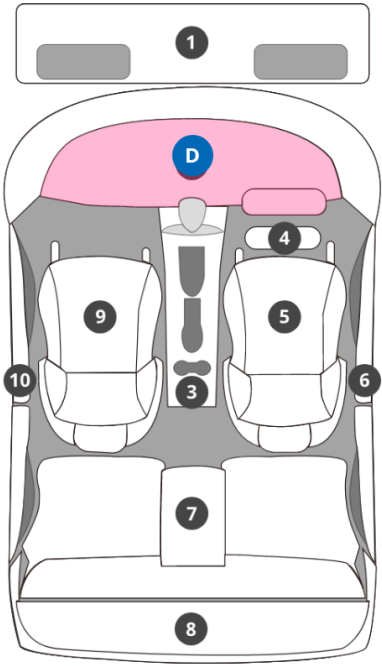
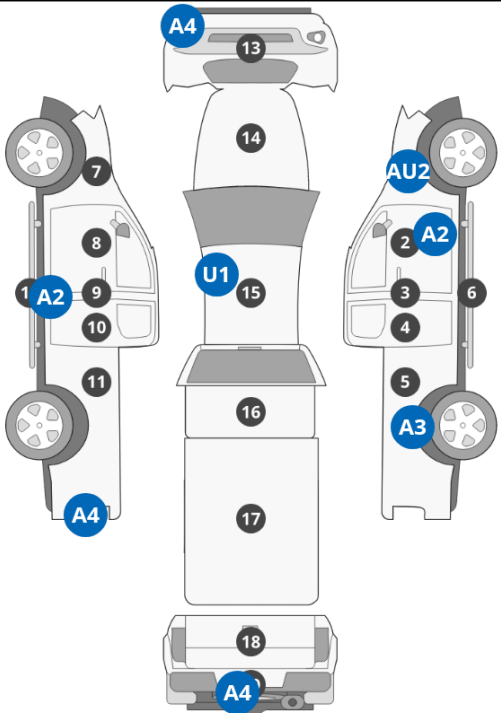
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	141.3	149	128	147
2	Boot Lid	146.6	182	124	134
3	Roof	121.2	147	126	108/104
4	Left Front Fender	155.6	157	158	152
5	Left Front Door	134.0	139	134	129
6	Center Panel Left	128.3	139	130	116
7	Left Rear Door				
8	Left Back Panel	330.3	209	570	212
9	Right Front Fender	151.6	145	161	149
10	Right Front Door	123.0	116	131	122
11	Center Panel Right	107.1	99	111	112
12	Right Rear Door				
13	Right Back Panel	161.0	188	113	182

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Rear Corner Panel - Repair Traces - Yes / (L) Side Gate - Scratch - Large / (R) Side Gate - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (L) Center Panel - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/with spare tire/jack and tools/No warranty booklet