

General Information

Date & Time: 08, Jul, 2026 09:31

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	22,709
Registration No.	NKU8772	Chassis No.	PA1B18F3X4298689
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



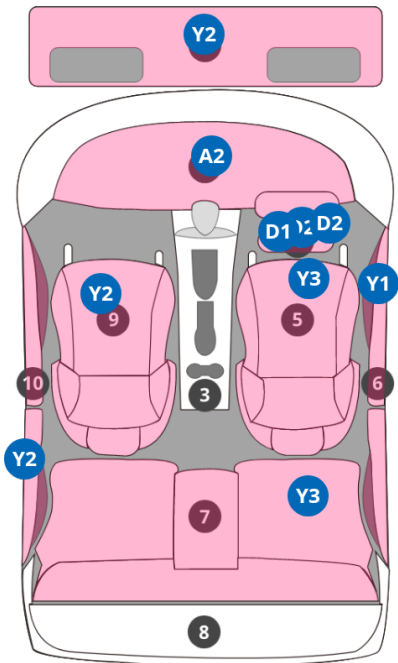
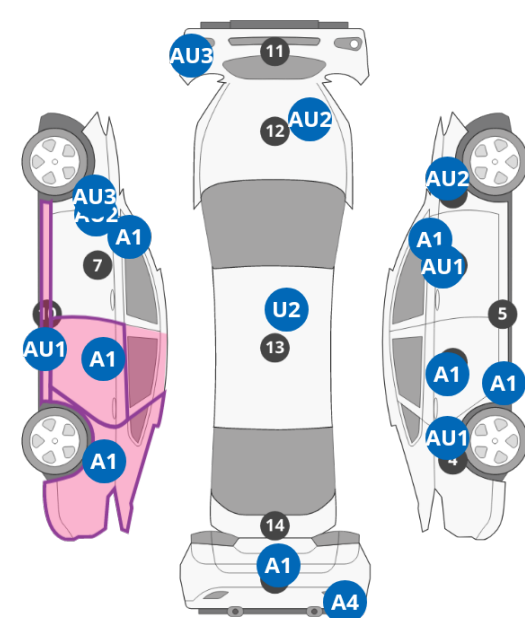
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.0	122	118	123
2	Boot Lid	119.6	121	109	129
3	Roof	152.7	111	107	282/111
4	Left Front Fender	105.6	104	104	109
5	Left Front Door	105.0	105	105	105
6	Center Panel Left				
7	Left Rear Door	513.6	181	1,124	236
8	Left Back Panel	269.6	211	419	179
9	Right Front Fender	108.3	108	112	105
10	Right Front Door	106.3	108	103	108
11	Center Panel Right				
12	Right Rear Door	111.6	107	107	121
13	Right Back Panel	109.0	108	109	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Rear Seat - Grime - Medium / Mat Other - Worked - Small / Carpet - Worked - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / Roof - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
With Lto plate, with spare tire and jack and tools, 3keys, no warranty booklet, scratches on headlights and taillights, battery weak