

General Information

Date & Time: 10, Jul, 2026 15:35

Make	Toyota	Model	Raize
YOM	2023	Odo Meter Reading	24,828
Registration No.	NFA5426	Chassis No.	MHKAA1BA9PJ087422
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	SUV
Colour	Black		

Body / Panel Condition



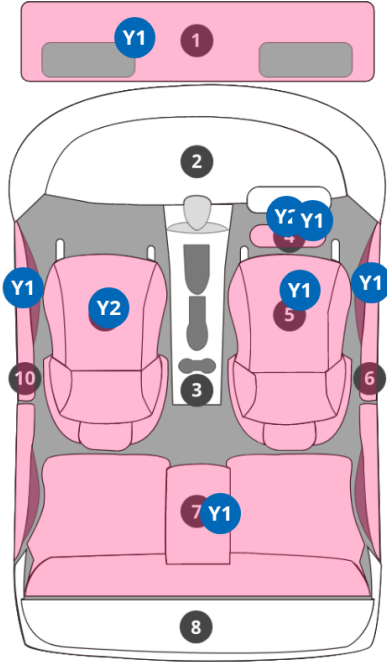
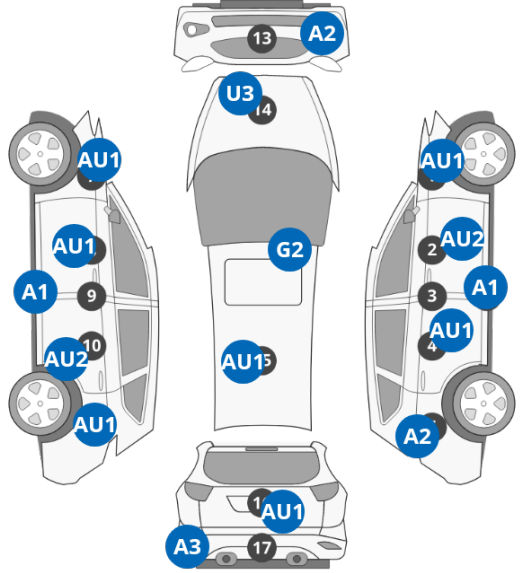
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.3	125	118	151
2	Boot Lid	118.3	113	129	113
3	Roof	110.7	112	103	111/117
4	Left Front Fender	141.0	131	153	139
5	Left Front Door	141.0	144	147	132
6	Center Panel Left				
7	Left Rear Door	136.0	133	142	133
8	Left Back Panel	118.3	121	112	122
9	Right Front Fender	141.0	139	157	127
10	Right Front Door	143.3	145	142	143
11	Center Panel Right				
12	Right Rear Door	134.0	127	135	140
13	Right Back Panel	119.3	119	123	116

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal / Ceiling - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with spare tire, with reverse camera, with manual and warranty booklet, with jack, no spare key, no tools, scratches and dent on exterior, scratches on taillight and headlight, check engine indicator, engine control system and VSC system indicator on, windshield issue.