

General Information

Date & Time: 10, Jul, 2026 15:48

Make	Toyota	Model	Hilux
YOM	2010	Odo Meter Reading	261,474
Registration No.	PUQ447	Chassis No.	MR0ER32GX06009223
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



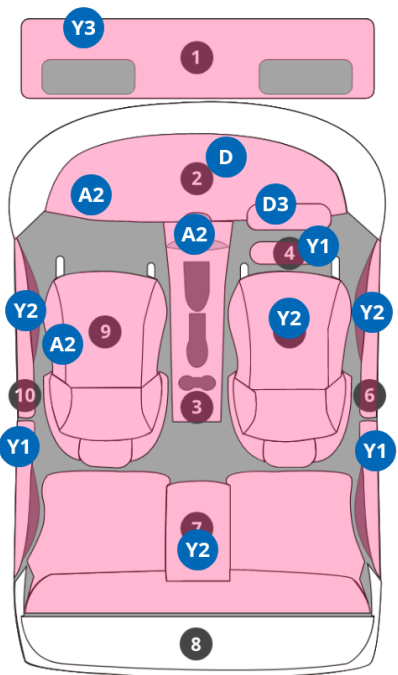
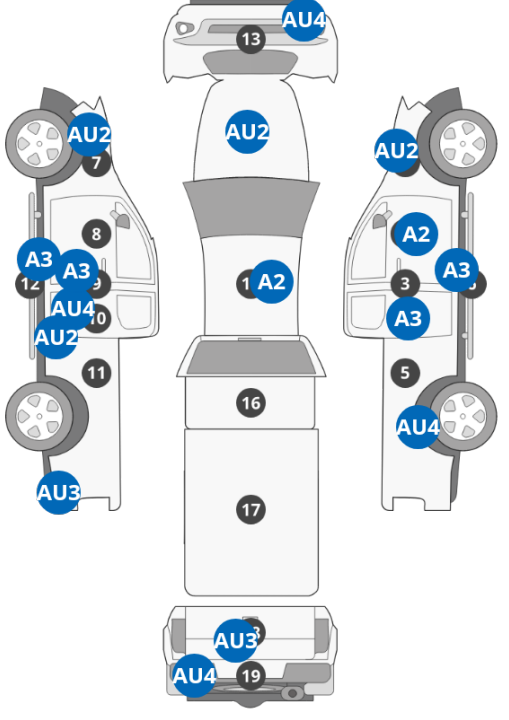
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	94.7	90	97	97
2	Boot Lid	102.3	106	100	101
3	Roof	85.5	86	61	99/97
4	Left Front Fender	109.6	107	117	105
5	Left Front Door	100.8	99	103	101
6	Center Panel Left				
7	Left Rear Door	102.5	106	104	98
8	Left Back Panel	105.5	100	109	108
9	Right Front Fender	104.0	102	108	102
10	Right Front Door	103.0	105	104	100
11	Center Panel Right				
12	Right Rear Door	100.8	94	100	108
13	Right Back Panel	98.7	87	108	101

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Loose, Deformed - Medium / Steering Wheel - Worn, Peel, Crack - Small / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Cut, Crack - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Side Gate - Scratch & Dent - Large / Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Side Gate - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Corner Panel - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Small / Overall Exterior - Worn as per age - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/no spare key/airbag lamp on/bypass horn/air recirculation switch issue/side mirror issue/plate light issue/front emblem missing/tailight and headlight cover issue/hairline scratches on the body/signal light issue/with seat cover