

General Information

Date & Time: 10, Jul, 2026 15:32

Make	Toyota	Model	Hiace
YOM	2019	Odo Meter Reading	341,023
Registration No.	DAL6553	Chassis No.	JTFJT02P0K5020977
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



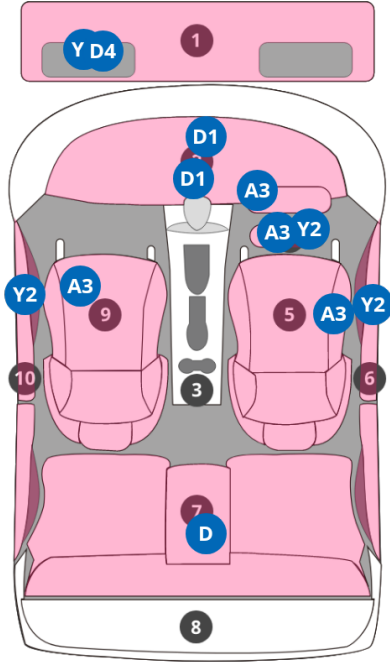
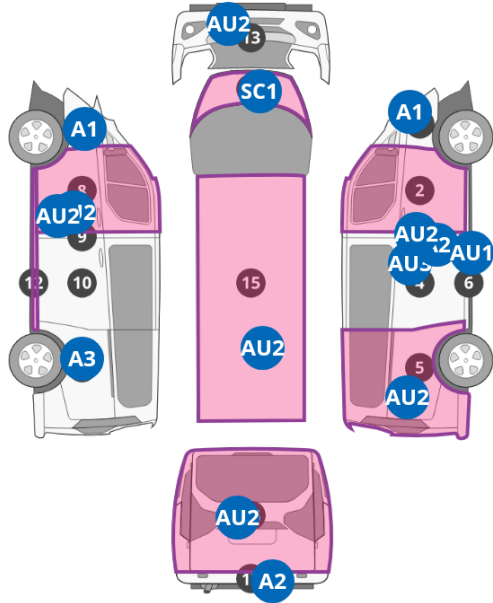
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	520.0	140	179	1,241
2	Boot Lid	143.8	174	60	198
3	Roof	87.4	77	80	73/120
4	Left Front Fender	81.2	88	85	71
5	Left Front Door	53.8	16	74	72
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	74.7	70	76	78
9	Right Front Fender	90.8	91	90	91
10	Right Front Door	53.1	19	70	71
11	Center Panel Right	82.5	91	77	80
12	Right Rear Door	77.1	74	76	82
13	Right Back Panel	629.3	802	923	163

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Cut, Crack - Medium / (R) Front Seat - Fray - Medium / Rear Seat - Worn - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Dashboard - Worked - Minimal / Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Worked - Large / Steering Wheel - Worn, Peel, Crack - Medium / Instrument Panel - Worked - Minimal	Remarks (R) Front Door - Repair Traces - Yes / Front Panel - Repair Traces - Yes / Front Panel - Replaced - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Center Panel - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Front Panel - Rust, Corrosion - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / Roof - Scratch & Dent - Small / Roof - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Door Lock - Issue - Yes

Inspector Notes
with LTO plate, with spare tire and key, with warranty and manual booklet, no tools and jack, issue on rear slide door, issue in sun visor, issue in glass slide rear door area, scratches and dent on exterior, scratches in taillight and headlight, issue on underchassis.