

General Information

Date & Time: 11, Jul, 2026 14:32

Make	Mitsubishi	Model	Mirage
YOM	2018	Odo Meter Reading	117,206
Registration No.	NDP3364	Chassis No.	PAEA13TJJJA006931
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



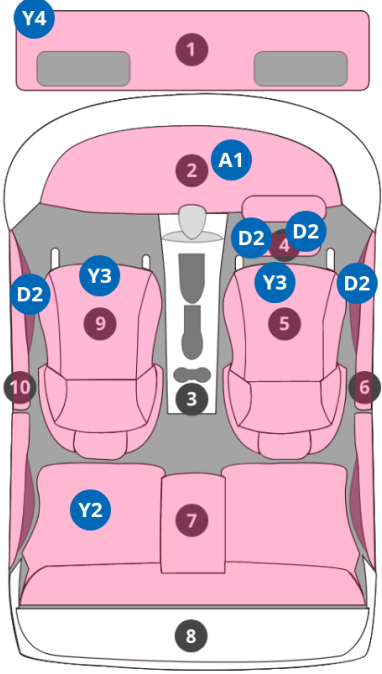
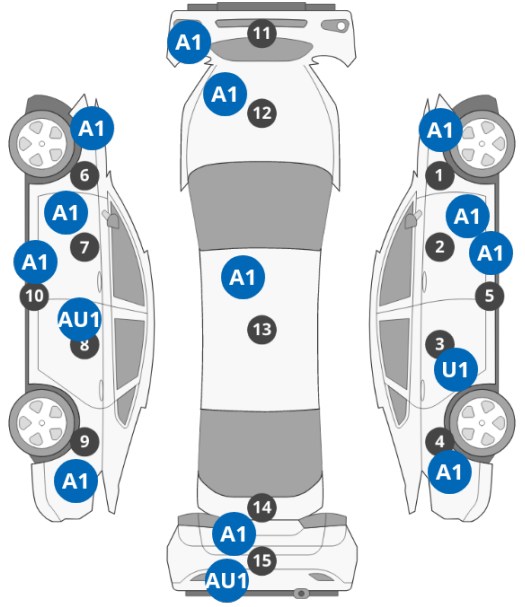
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	119	111	106
2	Boot Lid	105.0	104	109	102
3	Roof	97.7	98	98	99/97
4	Left Front Fender	106.0	102	101	115
5	Left Front Door	105.9	109	99	110
6	Center Panel Left				
7	Left Rear Door	107.3	108	106	108
8	Left Back Panel	110.0	115	108	107
9	Right Front Fender	104.3	107	103	103
10	Right Front Door	107.6	110	103	110
11	Center Panel Right				
12	Right Rear Door	108.0	109	104	111
13	Right Back Panel	125.3	104	140	132

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Small / Ceiling - Grime - Large / Overall Interior - Worn as per age - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Glove Box - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Overall Exterior - Worn as per age - Yes / Roof - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with Ito plate/warranty booklet/with hairlines scratches on the body/without tools and jack/without reverse camera/with driver seat issue/with plate light issue