

General Information

Date & Time: 10, Jul, 2026 15:33

Make	Mitsubishi	Model	Mirage
YOM	2018	Odo Meter Reading	77,181
Registration No.	NDP3354	Chassis No.	PAEA13TJJJA006955
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



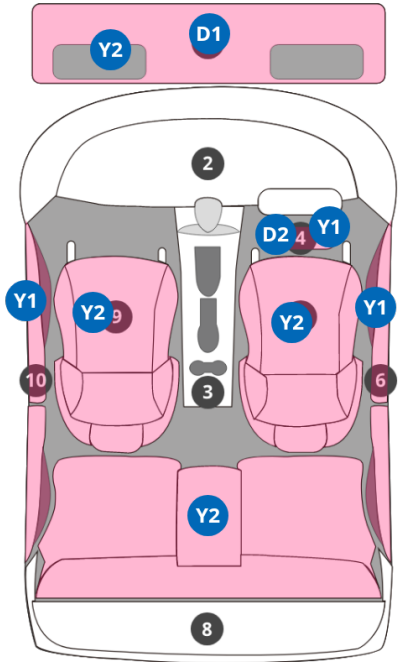
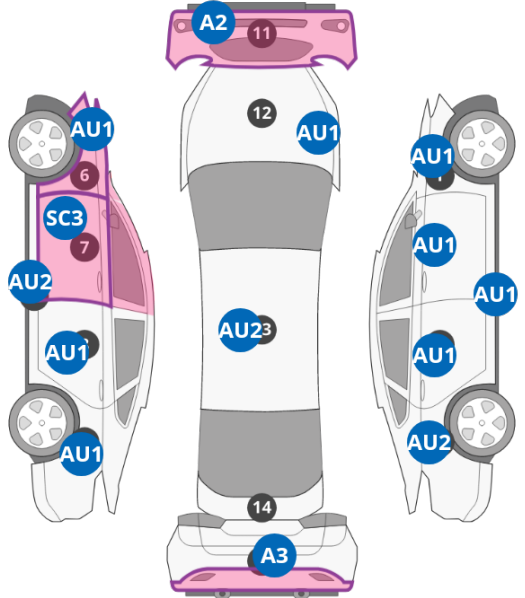
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	108	118	104
2	Boot Lid	109.6	108	115	106
3	Roof	101.6	99	107	102/98
4	Left Front Fender	108.3	110	104	111
5	Left Front Door	76.8	113	103	14
6	Center Panel Left				
7	Left Rear Door	110.3	126	103	102
8	Left Back Panel	131.3	143	141	110
9	Right Front Fender	114.6	125	110	109
10	Right Front Door	111.3	114	108	112
11	Center Panel Right				
12	Right Rear Door	106.6	109	103	108
13	Right Back Panel	113.0	104	111	124

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Ceiling - Crinkle - Minimal / Sunvisor, Sunglass Holder - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Rust, Corrosion - Medium / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with LTO plate, with spare tire and key, with warranty and manual booklet, no jack and tools, no reverse camera, scratches and dent on exterior, scratches in taillight and headlight, brake rotor noise, underchassis issue.