


General Information

Date & Time: 26, Feb, 2025 10:54

Make	Toyota	Model	Vios
YOM	2024	Mileage	33,519
Registration No.	DBF9419	Chassis No.	PA1B18F32R4252395
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition

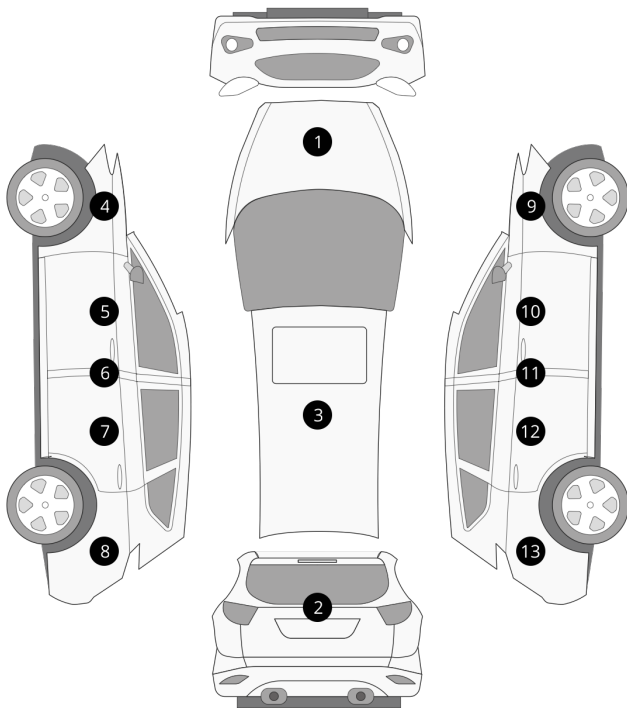


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.6	120	140	120
2	Boot Lid	120.6	115	122	125
3	Roof	108.2	117	103	106/107
4	Left Front Fender	110.6	112	110	110
5	Left Front Door	115.3	122	115	109
6	Center Panel Left				
7	Left Rear Door	112.0	117	108	111
8	Left Back Panel	125.0	142	120	113
9	Right Front Fender	111.6	118	106	111
10	Right Front Door	112.0	108	105	123
11	Center Panel Right				
12	Right Rear Door	110.3	112	110	109
13	Right Back Panel	127.6	111	116	156

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

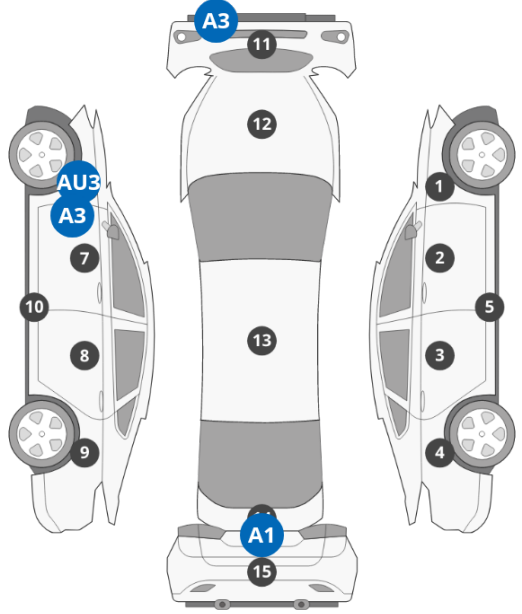Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Large / Rear Seat - Grime - Large	Remarks (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/with spare tire/with jack and tools//No warranty booklet