

General Information

Date & Time: 11, Jul, 2026 09:54

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	47,470
Registration No.	CCQ6765	Chassis No.	PAHACACA5S6429808
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



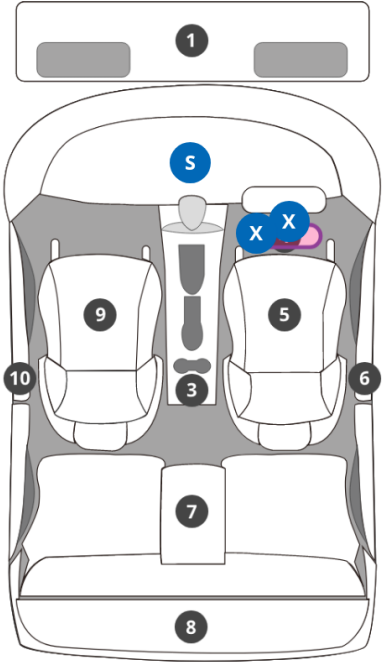
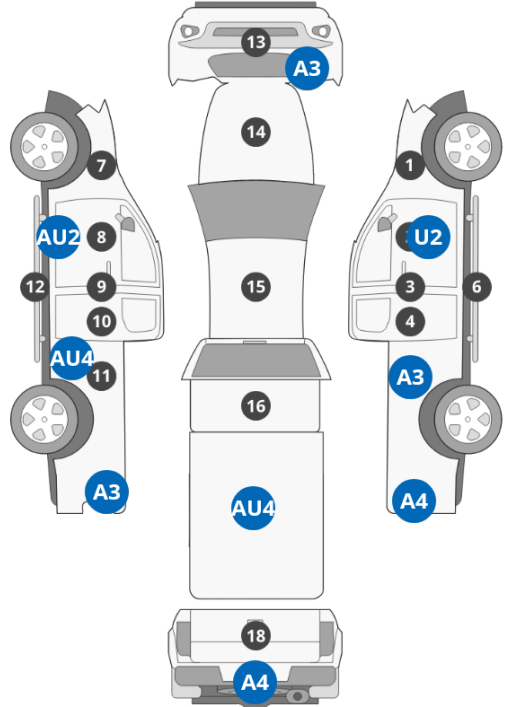
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.0	101	104	101
2	Boot Lid	111.6	114	111	110
3	Roof	101.4	101	100	103/102
4	Left Front Fender	102.3	104	101	102
5	Left Front Door	103.0	105	103	101
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	105.3	103	107	106
9	Right Front Fender	104.0	107	100	105
10	Right Front Door	106.0	105	108	105
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	106.6	106	108	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Overall Interior - Smell - Yes	Remarks (L) Side Gate - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Cargo Bed Floor - Scratch & Dent - Large / (R) Guard Frame - Scratch - Large / (R) Side Gate - Scratch - Medium / (R) Front Door, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Guard Frame - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
no jack and tools/ possible flooding/ light scratches around the exterior/ with spare tire and LTO plate/ with warranty booklet