

General Information

Date & Time: 11, Jul, 2026 15:51

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	15,006
Registration No.	NJL2469	Chassis No.	PAHACACA0T6435449
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



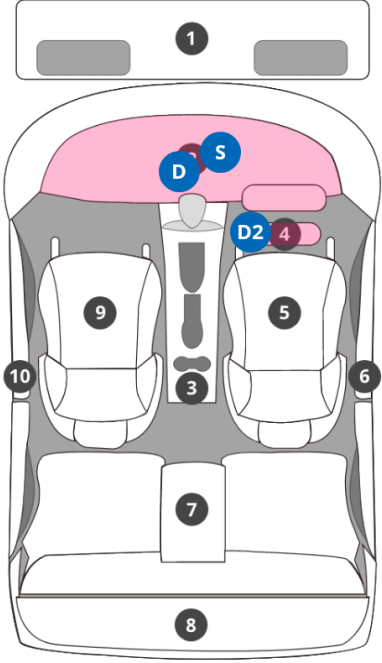
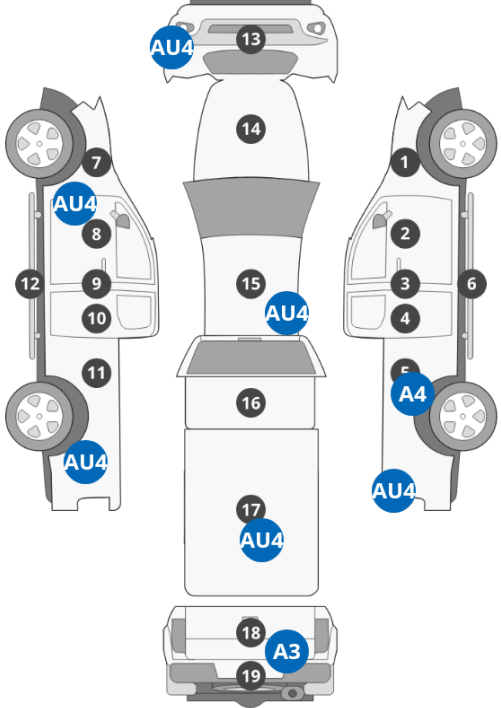
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.9	101	108	97
2	Boot Lid	46.2	50	43	46
3	Roof	120.5	130	126	115/111
4	Left Front Fender	109.3	107	102	119
5	Left Front Door	110.3	114	108	109
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	65.6	69	73	55
9	Right Front Fender	103.0	105	104	100
10	Right Front Door	104.6	102	104	108
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	57.7	51	57	65

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes	Remarks (L) Side Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Side Gate - Scratch - Large / (R) Guard Frame - Scratch & Dent - Large / Rear Gate - Scratch - Medium / Cargo Bed Floor - Scratch & Dent - Large / Roof - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
light scratches around the exterior/ possible flooding/ driver door issue/ with jack and spare tire/ with LTO plate and warranty booklet/ incomplete tools