

General Information

Date & Time: 11, Jul, 2026 13:39

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	12,853
Registration No.	CDC1232	Chassis No.	PAHACACA5S6433101
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



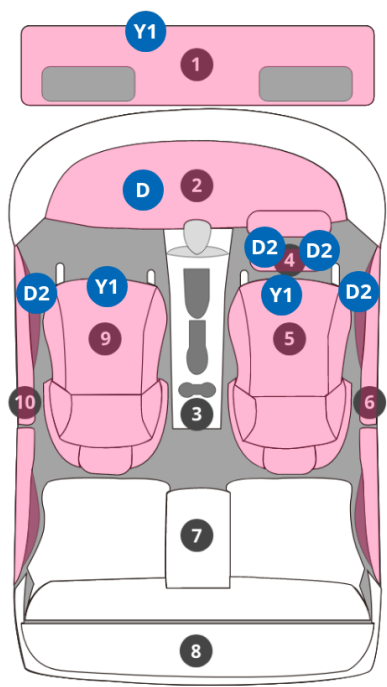
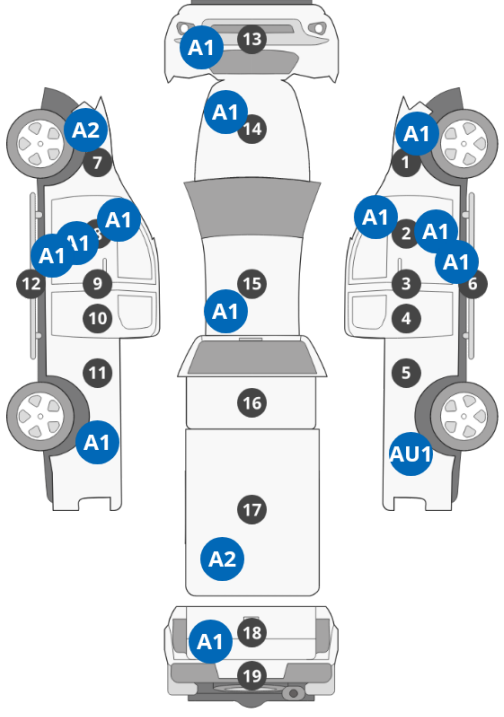
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.1	108	102	99
2	Boot Lid	73.2	62	63	95
3	Roof	115.0	124	126	108/102
4	Left Front Fender	111.0	106	114	113
5	Left Front Door	115.0	116	113	116
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	69.9	75	70	66
9	Right Front Fender	107.3	113	105	104
10	Right Front Door	106.3	105	105	109
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	78.1	83	67	84

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Ceiling - Grime - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Minimal / Rear Gate - Scratch - Minimal / Cargo Bed Floor - Scratch - Small / (L) Side Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes

with Ito plate/with spare key/with tools and jack/with hairlines scratches patches on the body/with spare tire/with warranty booklet/without reverse camera