

General Information

Date & Time: 15, Jul, 2026 11:05

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	87,562
Registration No.	NHS6373	Chassis No.	PA1B18F39R4263376
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



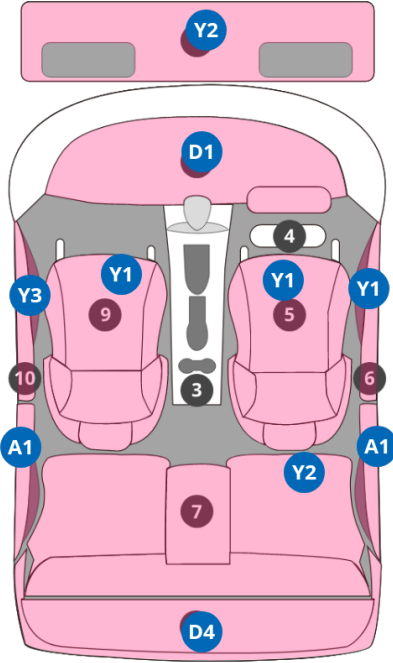
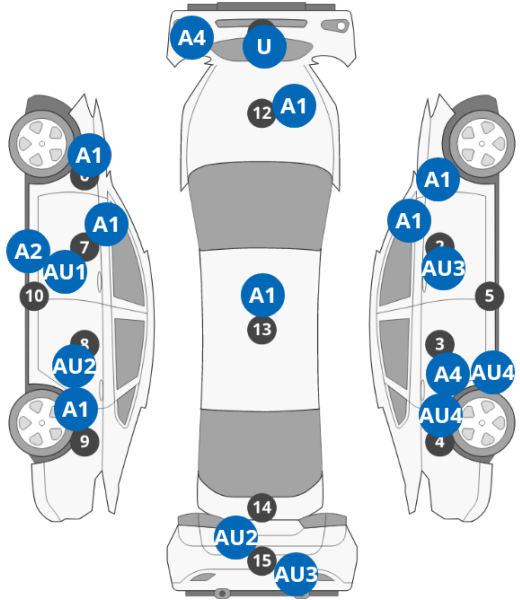
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	122	111	116
2	Boot Lid	112.6	114	109	115
3	Roof	95.1	102	93	95/90
4	Left Front Fender	102.6	97	105	106
5	Left Front Door	99.7	102	99	98
6	Center Panel Left				
7	Left Rear Door	105.9	107	100	111
8	Left Back Panel	114.6	127	112	105
9	Right Front Fender	111.3	109	113	112
10	Right Front Door	107.6	112	106	105
11	Center Panel Right				
12	Right Rear Door	99.7	98	99	103
13	Right Back Panel	108.6	103	108	115

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Rear Seat - Grime - Small / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Trim - Grime - Minimal / Trunk Room - Loose, Deformed - Large / (L) Rear Trim - Cut, Crack - Minimal / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Minimal / Dashboard - Loose, Deformed - Minimal / (R) Front Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / Member (Bolted) - Dent - Yes
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Shift Shock - Function - Weak

Inspector Notes
With Lto plate, with spare tire and jack, 3keys, no warranty booklet and tools ,scratches on headlights and taillights , right fender light issue, abnormal vibration on engine, worn tires