

General Information

Date & Time: 15, Jul, 2026 15:17

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	9,443
Registration No.	CCR7744	Chassis No.	PAHACACAXS6429500
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



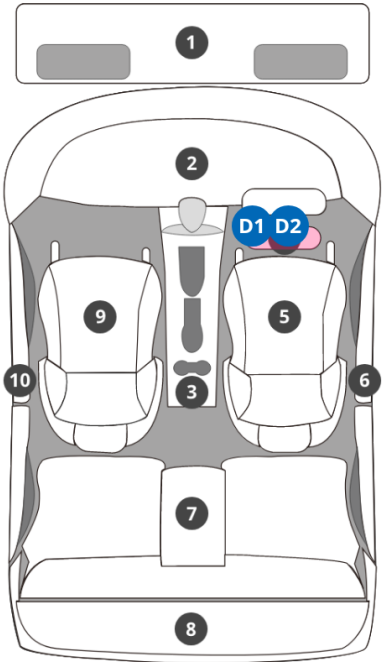
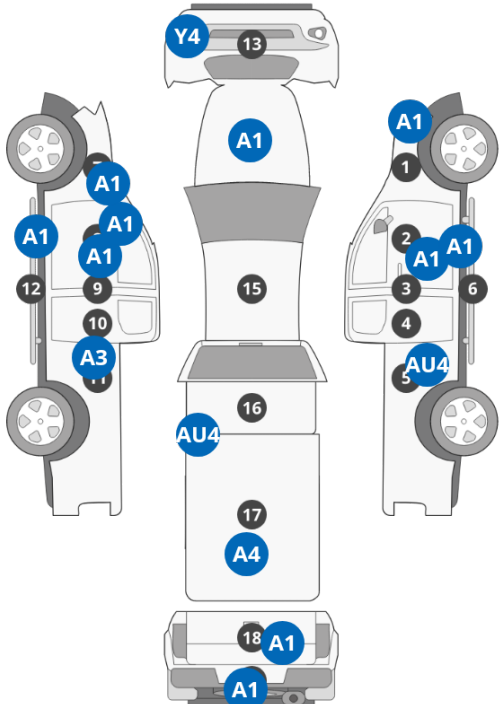
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.8	114	113	97
2	Boot Lid	48.9	52	43	51
3	Roof	116.2	123	124	109/109
4	Left Front Fender	110.0	106	110	114
5	Left Front Door	106.3	104	108	107
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	57.3	56	61	55
9	Right Front Fender	109.4	120	111	97
10	Right Front Door	108.0	103	113	108
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	58.1	59	66	49

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Large / Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Side Gate - Scratch - Medium / Roof - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal / Cargo Bed Floor - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, scratches on headlights,