

General Information

Date & Time: 10, Jul, 2026 18:37

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	51,828
Registration No.	NKP9541	Chassis No.	PAHACACA7S6424166
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



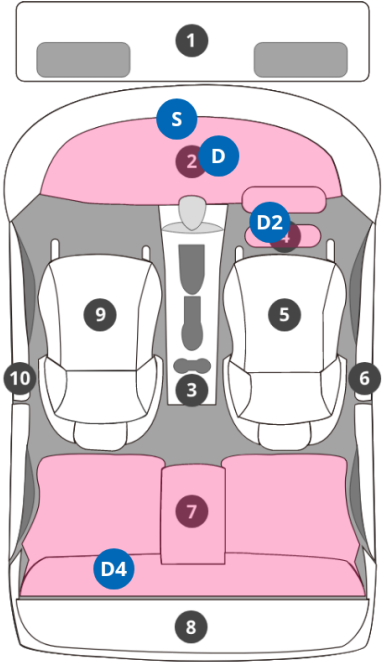
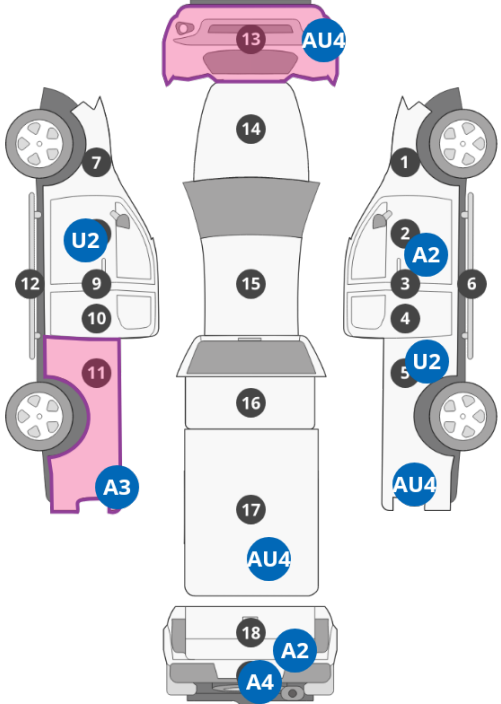
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.0	106	100	100
2	Boot Lid	47.0	48	44	49
3	Roof	111.5	116	116	105/109
4	Left Front Fender	102.7	94	105	109
5	Left Front Door	100.3	99	100	102
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	65.1	61	58	77
9	Right Front Fender	99.7	101	106	92
10	Right Front Door	99.8	97	101	102
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	65.4	66	65	65

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Trim Other - Worked - Large	Remarks (L) Side Gate - Partially Missing - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Guard Frame - Scratch & Dent - Large / (R) Side Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Rear Gate - Scratch - Small / (L) Side Gate - Scratch - Medium / (L) Front Door, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Small / Cargo Bed Floor - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
possible flooding/ rear door cannot be opened/ missing fuell lid cover/ light scratches around the exterior/ no jack and tools/ no warranty booklet/ with spare tire and LTO plate