

General Information

Date & Time: 15, Jul, 2026 15:16

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	46,172
Registration No.	CCF4008	Chassis No.	PA1B18F38R426J358
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



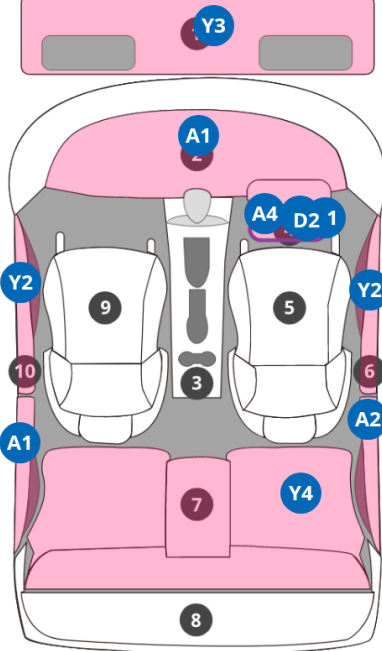
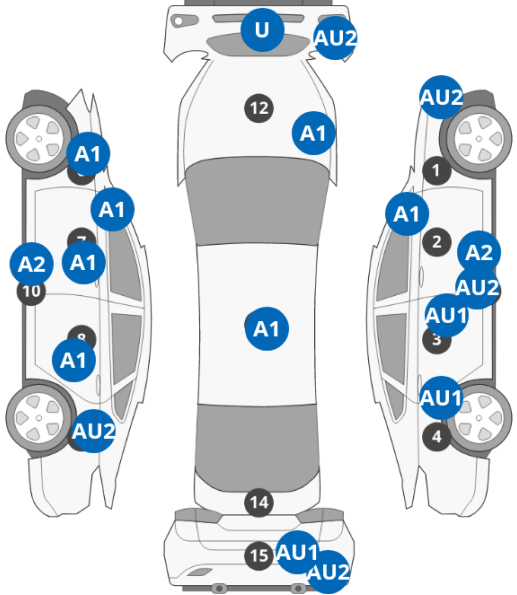
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	122	114	121
2	Boot Lid	129.3	129	122	137
3	Roof	101.3	107	104	94/100
4	Left Front Fender	176.3	188	174	167
5	Left Front Door	108.6	109	108	109
6	Center Panel Left				
7	Left Rear Door	108.6	115	108	103
8	Left Back Panel	112.3	116	116	105
9	Right Front Fender	106.0	108	105	105
10	Right Front Door	105.6	105	108	104
11	Center Panel Right				
12	Right Rear Door	103.9	100	111	101
13	Right Back Panel	112.3	106	107	124

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Missing - Yes / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Large / Carpet - Worked - Minimal / (R) Rear Trim - Cut, Crack - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal / (L) Rear Trim - Cut, Crack - Minimal	Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with spare tire and jack, with warranty, 2keys, no tools, scratches on headlights and taillights, possible flooding, left fender light issue