

General Information

Date & Time: 15, Jul, 2026 09:31

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	8,673
Registration No.	CCQ7085	Chassis No.	PAHACACA0S6431823
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



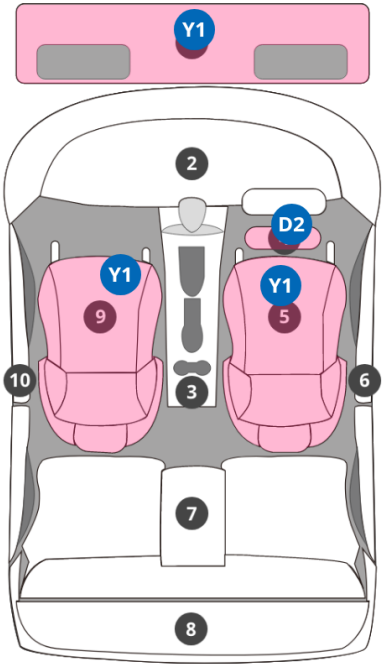
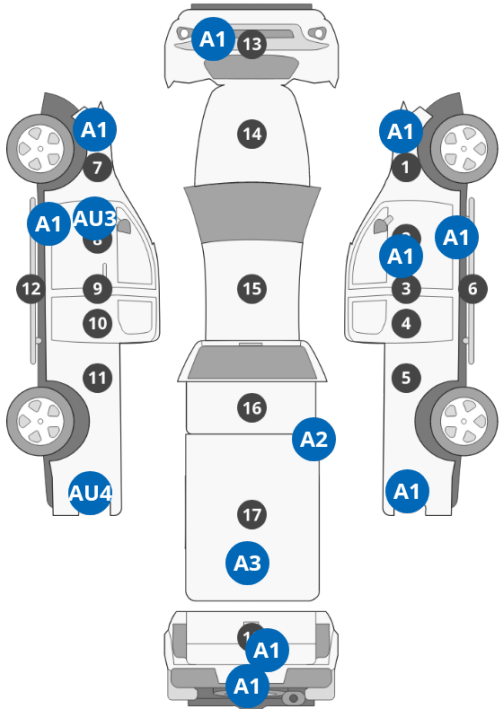
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	108	118	101
2	Boot Lid	72.3	77	67	73
3	Roof	118.2	129	123	113/108
4	Left Front Fender	114.3	112	108	123
5	Left Front Door	116.3	112	119	118
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	60.0	65	56	60
9	Right Front Fender	110.6	125	104	103
10	Right Front Door	107.6	105	103	115
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	61.7	63	59	63

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch - Small / (R) Side Gate - Scratch - Minimal / Rear Gate - Scratch - Minimal / Cargo Bed Floor - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Side Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

With Lto plate, with spare tire and jack, with warranty booklet, 2keys, scratches on headlights