

General Information

Date & Time: 13, Jul, 2026 18:38

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	50,292
Registration No.	NKO9390	Chassis No.	MHFAA1BY3S0039392
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Green		

Body / Panel Condition



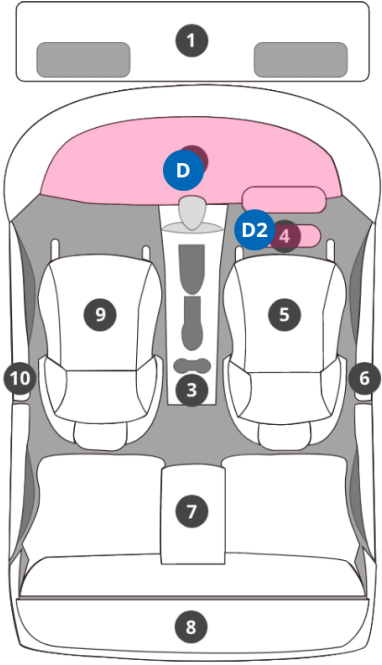
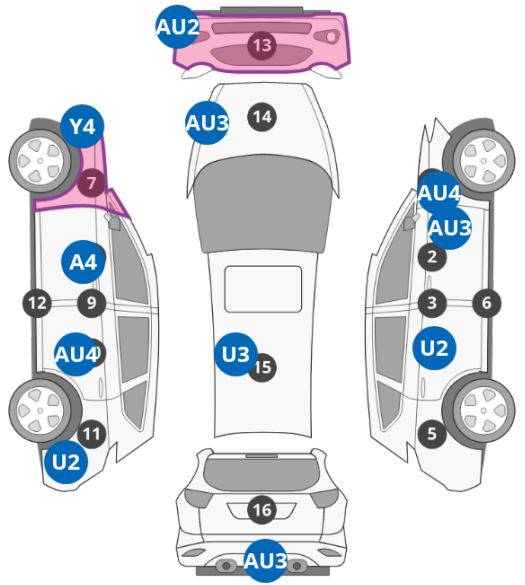
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	113	117	120
2	Boot Lid	112.3	111	123	103
3	Roof	125.5	135	127	129/111
4	Left Front Fender	443.0	305	681	343
5	Left Front Door	125.0	115	123	137
6	Center Panel Left				
7	Left Rear Door	119.3	119	115	124
8	Left Back Panel	120.0	133	120	107
9	Right Front Fender	110.2	119	112	100
10	Right Front Door	114.3	123	115	105
11	Center Panel Right				
12	Right Rear Door	119.0	122	114	121
13	Right Back Panel	109.3	105	105	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small	Remarks (L) Front Fender - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Door, Molding - Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Medium / (L) Front Fender, Molding - Crack, Gap - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Large / Roof - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no jack and tools/ fog light issue/ light scratches around the exterior/ with spare tire and LTO plate/ with warranty booklet