

General Information

Date & Time: 11, Jul, 2026 13:56

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	21,142
Registration No.	NLB5856	Chassis No.	PAHACACA7S6430328
CC	2.4	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



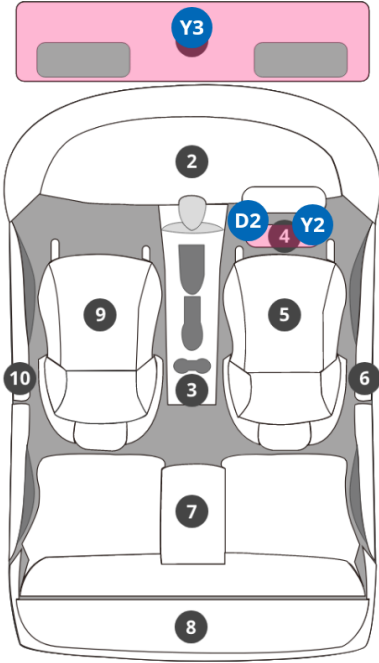
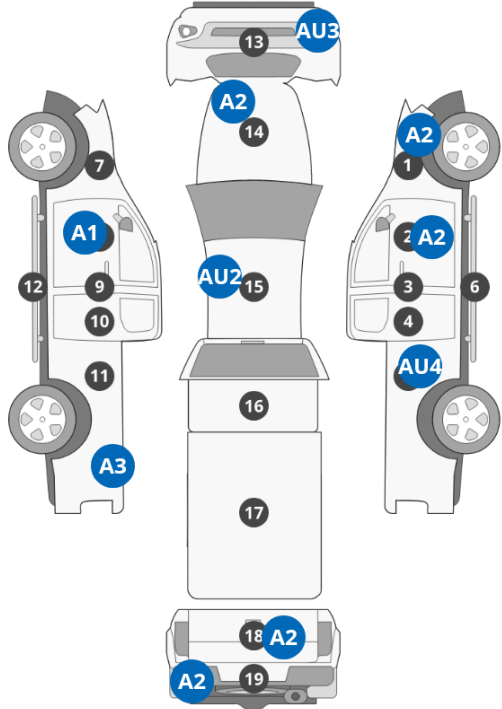
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	111	113	115
2	Boot Lid	59.9	66	55	59
3	Roof	109.2	114	111	108/104
4	Left Front Fender	103.8	107	105	100
5	Left Front Door	105.0	107	108	100
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	73.1	69	76	74
9	Right Front Fender	112.3	106	110	121
10	Right Front Door	106.3	103	106	110
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	75.3	75	83	68

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks (R) Side Gate - Scratch & Dent - Large / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Roof - Scratch & Dent - Small / (L) Side Gate - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Without warranty booklet, jack and tools. With spare tire. 1 key. With LTO plate.