

General Information

Date & Time: 03, Mar, 2025 13:37

Make	Toyota	Model	Vios
YOM	2024	Mileage	21,880
Registration No.	NHS1731	Chassis No.	PA1B18F37P4233676
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



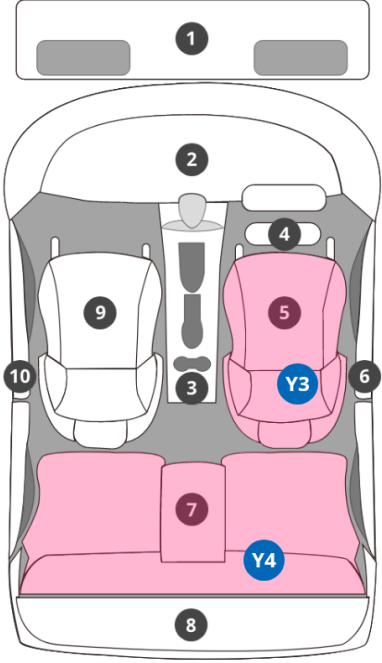
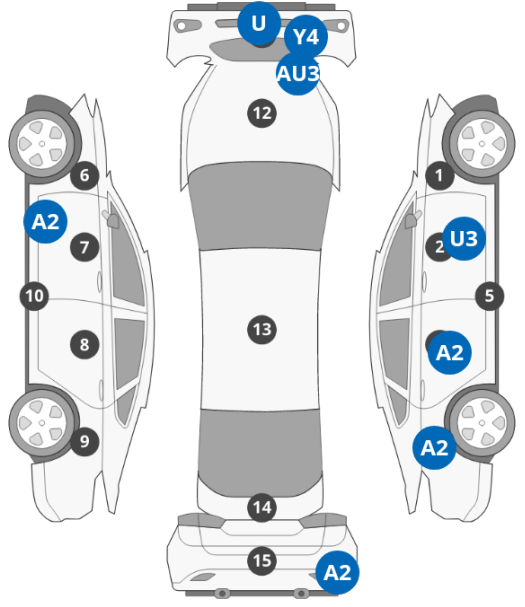
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	110	100	110
2	Boot Lid	100.2	94	102	105
3	Roof	102.3	103	101	99/107
4	Left Front Fender	94.8	94	93	98
5	Left Front Door	109.1	99	99	130
6	Center Panel Left				
7	Left Rear Door	89.7	89	85	96
8	Left Back Panel	86.9	92	85	84
9	Right Front Fender	99.7	94	102	103
10	Right Front Door	104.6	110	103	101
11	Center Panel Right				
12	Right Rear Door	103.9	95	103	114
13	Right Back Panel	112.6	116	104	118

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large	Remarks Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / (R) Front Door, Molding - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes

Inspector Notes
no warranty booklet/ with tools/ with LTO plate / with spare tire and jack