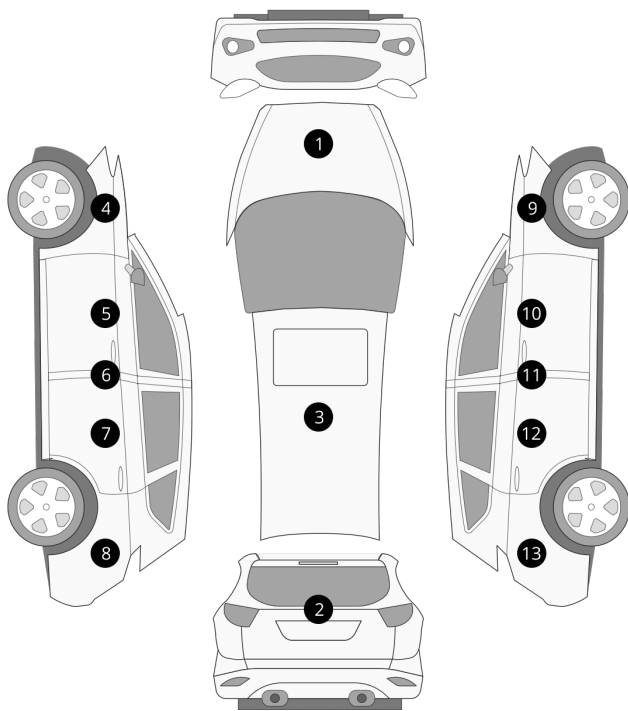


General Information

Date & Time: 11, Jul, 2026 14:01

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	36,876
Registration No.	NJK8785	Chassis No.	PAHACACA4S6429573
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



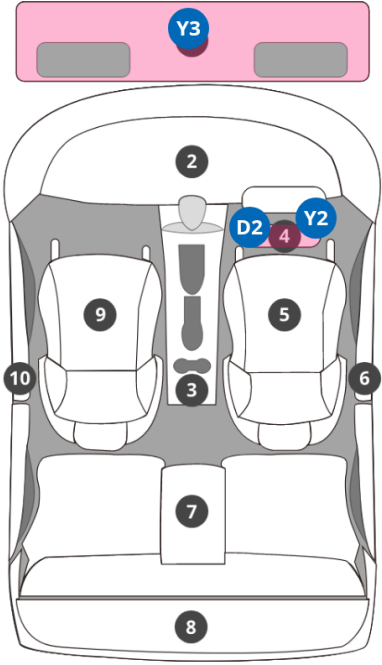
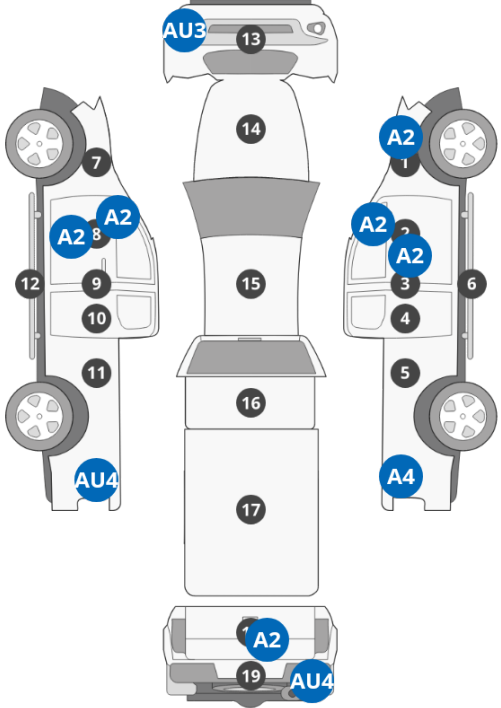
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	121	114	113
2	Boot Lid	49.8	52	49	48
3	Roof	109.0	111	112	103/110
4	Left Front Fender	107.3	101	113	108
5	Left Front Door	110.0	111	110	109
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	63.9	67	65	60
9	Right Front Fender	109.6	105	114	110
10	Right Front Door	109.0	105	109	113
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	74.3	69	82	72

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Side Gate - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

With warranty booklet, spare tire, jack and tools. 2 keys. With LTO plate.