

General Information

Date & Time: 15, Jul, 2026 09:01

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	23,759
Registration No.	EAL4314	Chassis No.	PA1B18F30S4302460
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



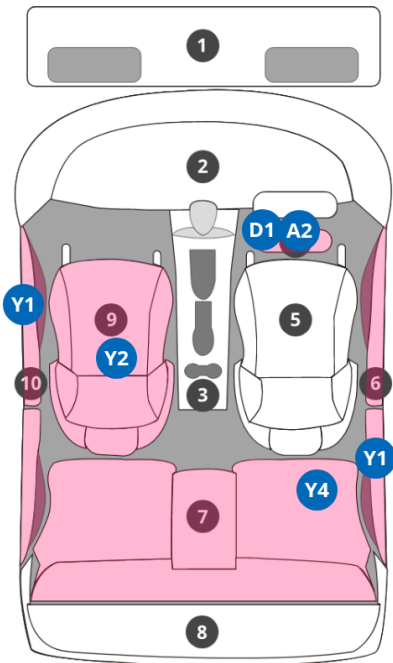
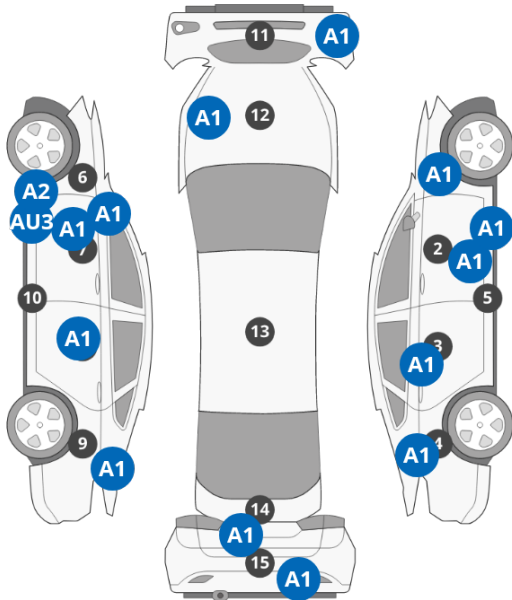
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	121	109	114
2	Boot Lid	120.0	117	116	127
3	Roof	100.6	101	98	101/102
4	Left Front Fender	106.0	102	109	107
5	Left Front Door	107.3	104	108	110
6	Center Panel Left				
7	Left Rear Door	111.6	108	111	116
8	Left Back Panel	114.6	118	118	108
9	Right Front Fender	114.6	115	111	118
10	Right Front Door	110.6	106	110	116
11	Center Panel Right				
12	Right Rear Door	111.0	105	107	121
13	Right Back Panel	108.6	101	105	120

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C		Exterior Evaluation : B	
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Rear Seat - Grime - Large / (R) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Cut, Crack - Small / Carpet - Worked - Minimal / (L) Front Seat - Grime - Small		Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Defects not found	

Inspector Notes

With Lto plate, with jack and tools, 3keys, no spare tire and warranty booklet, scratches on headlights and taillights, worn front tires