

General Information

Date & Time: 13, Jul, 2026 18:43

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	51,442
Registration No.	NKI7223	Chassis No.	PA1B18F35R4262791
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



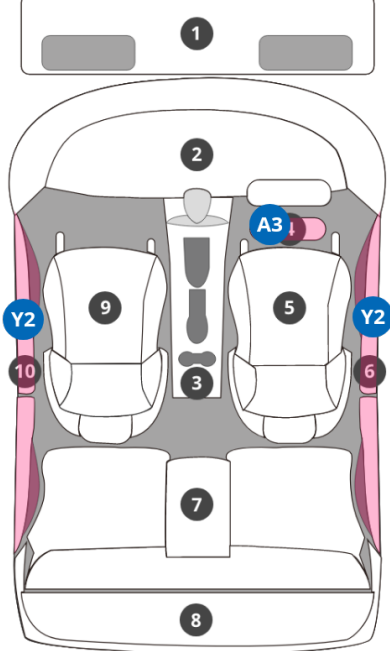
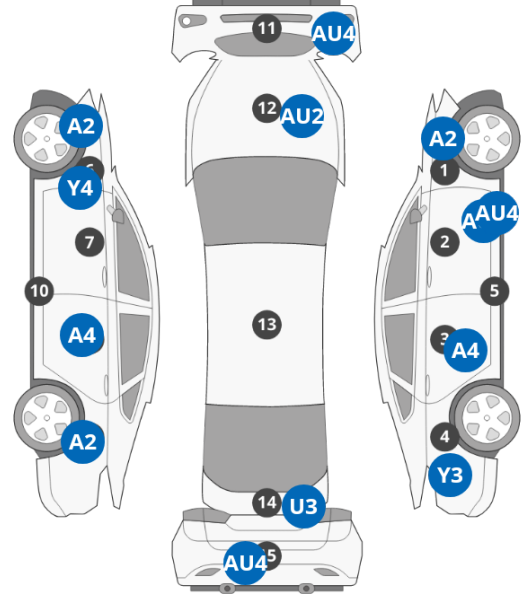
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.3	113	96	113
2	Boot Lid	99.8	101	99	100
3	Roof	95.9	106	96	88/94
4	Left Front Fender	99.2	100	98	100
5	Left Front Door	376.3	849	146	134
6	Center Panel Left				
7	Left Rear Door	100.2	103	101	97
8	Left Back Panel	111.6	121	111	103
9	Right Front Fender	103.5	100	103	108
10	Right Front Door	131.6	138	91	166
11	Center Panel Right				
12	Right Rear Door	175.3	171	150	205
13	Right Back Panel	153.3	108	148	204

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Crack, Gap - Medium / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Crack, Gap - Large / (L) Front Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no jack and tools/ possible flooding/ no warranty booklet/ light scratches around the exterior/with LTO plate and spare tire