

General Information

Date & Time: 15, Jul, 2026 11:02

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	14,390
Registration No.	CCD4119	Chassis No.	PA1B18F32R4255975
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



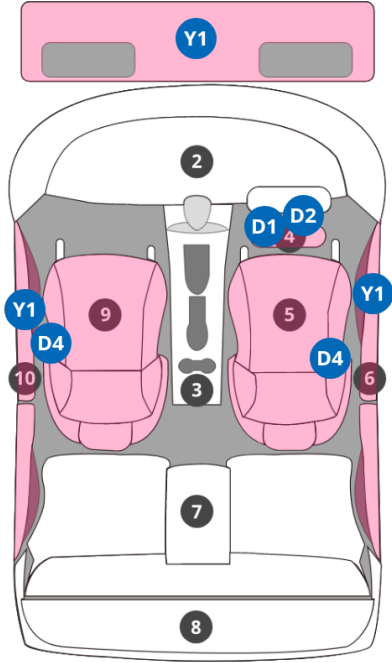
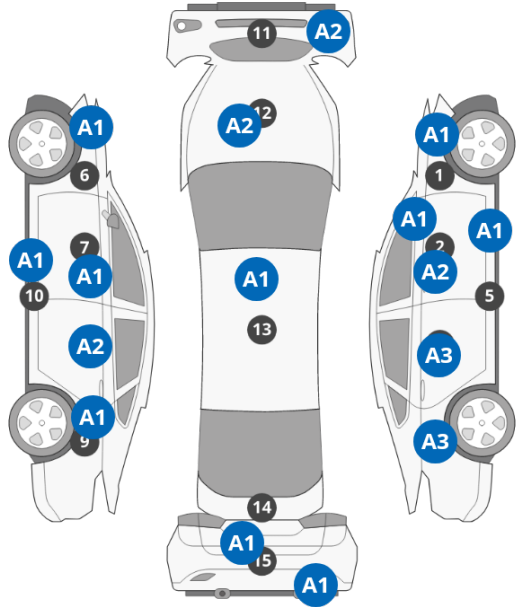
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	114	102	107
2	Boot Lid	117.3	114	119	119
3	Roof	94.9	97	95	94/94
4	Left Front Fender	98.6	93	100	103
5	Left Front Door	102.7	98	103	107
6	Center Panel Left				
7	Left Rear Door	110.6	117	110	105
8	Left Back Panel	106.3	107	106	106
9	Right Front Fender	105.8	110	108	100
10	Right Front Door	98.2	96	99	100
11	Center Panel Right				
12	Right Rear Door	109.3	100	109	119
13	Right Back Panel	104.5	102	99	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal / (R) Front Seat belt - Loose, Deformed - Large / (L) Front Seat belt - Loose, Deformed - Large	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Seat Belts - Issue - Yes

Inspector Notes
With Lto plate, with warranty booklet and tools and Jack, 2keys, no spare tire, scratches on headlights, airbag warning lamp on, abs warning lamp on, traction control lamp on,