

General Information

Date & Time: 15, Jul, 2026 15:04

Make	Chevrolet	Model	Captiva
YOM	2011	Odo Meter Reading	124,693
Registration No.	TZI409	Chassis No.	KL1CA26R1BH304487
CC	2.0	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



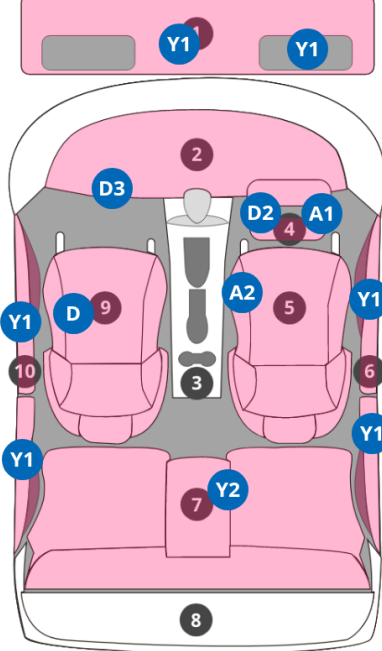
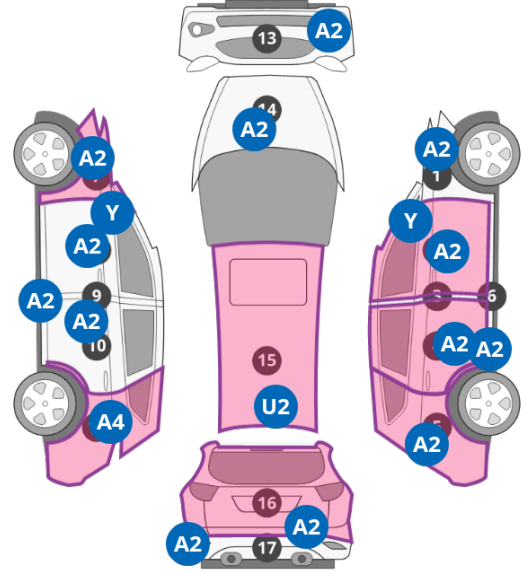
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	153.3	135	176	149
2	Boot Lid	371.0	190	131	792
3	Roof	154.5	172	108	165/173
4	Left Front Fender	122.0	124	132	110
5	Left Front Door	130.6	125	138	129
6	Center Panel Left				
7	Left Rear Door	136.3	144	132	133
8	Left Back Panel	124.6	132	124	118
9	Right Front Fender	128.6	124	129	133
10	Right Front Door	389.3	887	155	126
11	Center Panel Right				
12	Right Rear Door	350.0	252	160	638
13	Right Back Panel	113.3	105	109	126

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Seat - Cut, Crack - Small / (L) Front Seat - Worn - Yes / (R) Front Floor Mat - Cut, Crack - Minimal / (L) Front Floor Mat - Worked - Small / Dashboard - Loose, Deformed - Medium / Ceiling - Grime - Minimal / Sunvisor, Sunglass Holder - Grime - Minimal / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Crack - Damaged / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Roof - Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Crack - Cracks / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Overall Exterior - Worn as per age - Yes
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Shift Shock - Function - Weak / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak

Inspector Notes
with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/with spare key/check engine lamp on/abs lamp on/shift shock/transmission issue/worn out seat belt/retractable side mirror issue/rear wiper issue/remote key issue/fog lights issue/with blurry rear camera/aircon weak/hazard light switch issue/scratches on taillight and headlight cover/sun visor issue/panel meter issue/hard to start/hairline scratches on the body