

General Information

Date & Time: 15, Jul, 2026 08:15

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	50,724
Registration No.	NFR7299	Chassis No.	PA1B18F32R4256110
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



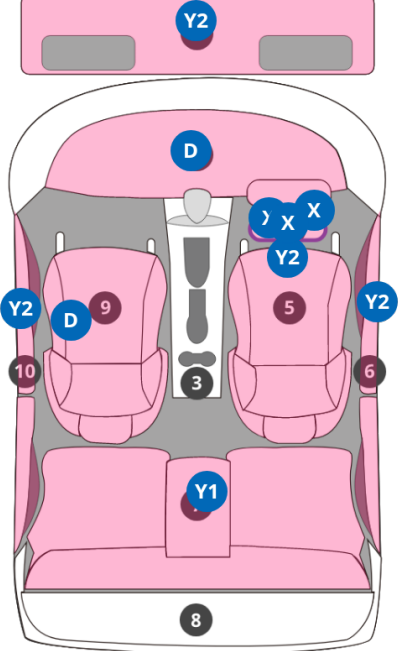
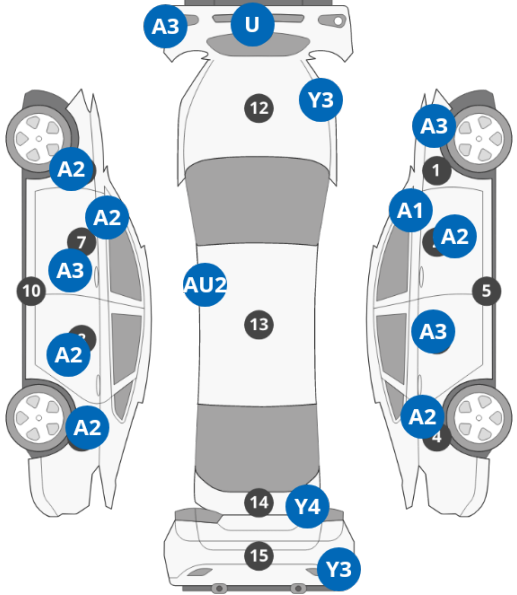
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	157.0	167	150	154
2	Boot Lid	107.1	98	106	118
3	Roof	112.4	95	105	107/143
4	Left Front Fender	138.0	127	132	155
5	Left Front Door	157.0	164	139	168
6	Center Panel Left				
7	Left Rear Door	109.1	125	106	97
8	Left Back Panel	101.1	105	96	103
9	Right Front Fender	95.0	94	99	92
10	Right Front Door	90.3	93	87	91
11	Center Panel Right				
12	Right Rear Door	103.6	102	98	111
13	Right Back Panel	100.0	99	95	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Minimal / Ceiling - Grime - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes	Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Crack, Gap - Medium / Roof - Scratch & Dent - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, repair marks on tail light, engine under cover missing, rear right fender traces of bending