


General Information

Date & Time: 01, Mar, 2025 13:45

Make	Toyota	Model	Vios
YOM	2024	Mileage	21,607
Registration No.	NHM3043	Chassis No.	PA1B18F37P4238246
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition

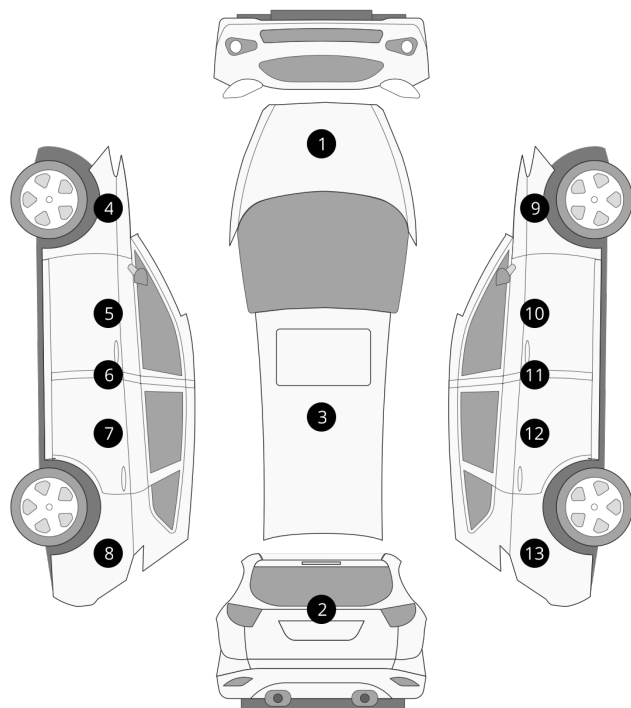


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	109	108	113
2	Boot Lid	166.3	168	165	166
3	Roof	96.3	99	98	89/100
4	Left Front Fender	98.5	103	93	100
5	Left Front Door	102.6	104	104	100
6	Center Panel Left				
7	Left Rear Door	100.6	106	101	95
8	Left Back Panel	103.1	108	105	96
9	Right Front Fender	105.3	115	98	103
10	Right Front Door	107.0	109	103	109
11	Center Panel Right				
12	Right Rear Door	107.9	98	100	126
13	Right Back Panel	106.0	104	99	115

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

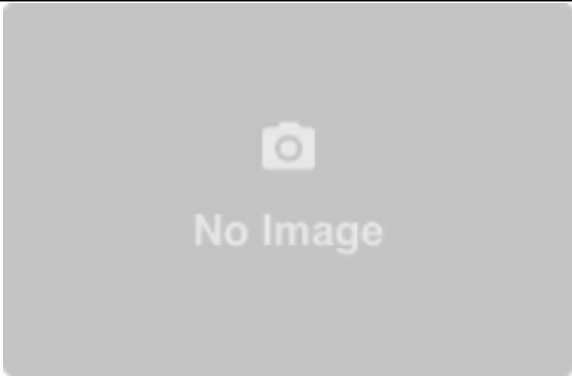Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large	Remarks (L) Rear Fender, Molding - Dent - Minimal / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/with spare tire/with jack and tools/with warranty booklet