

General Information

Date & Time: 14, Jul, 2026 15:42

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	18,503
Registration No.	NJK1646	Chassis No.	PA1B18F35S4297899
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



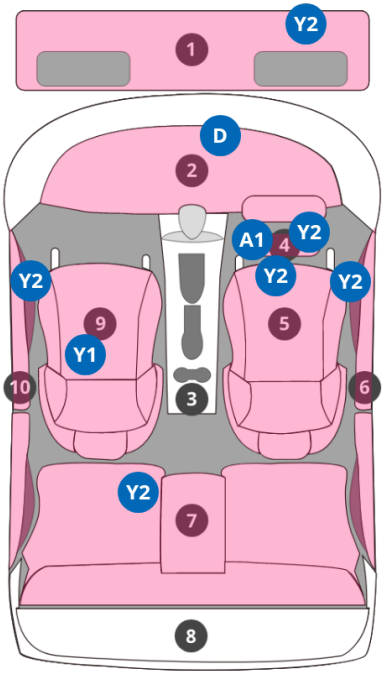
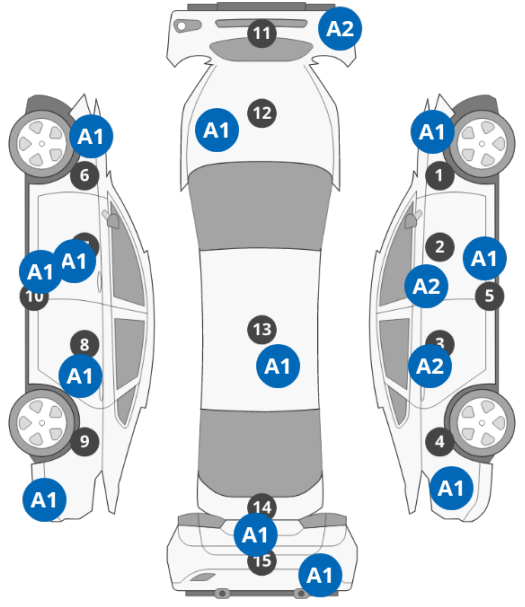
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	129	118	101
2	Boot Lid	124.0	124	122	126
3	Roof	105.2	111	109	100/101
4	Left Front Fender	110.0	109	107	114
5	Left Front Door	109.6	115	107	107
6	Center Panel Left				
7	Left Rear Door	105.3	109	106	101
8	Left Back Panel	111.3	117	109	108
9	Right Front Fender	108.6	117	101	108
10	Right Front Door	110.3	109	108	114
11	Center Panel Right				
12	Right Rear Door	112.3	109	111	117
13	Right Back Panel	117.3	106	108	138

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Cut, Crack - Minimal / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small / Rear Seat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with Ito plate/without warranty booklet/with spare tire/with reverse camera/with tools and jack/with hairlines scratches on the body/without spare key