

General Information

Date & Time: 14, Jul, 2026 15:56

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	42,984
Registration No.	VAB7286	Chassis No.	PA1B18F38R4265927
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



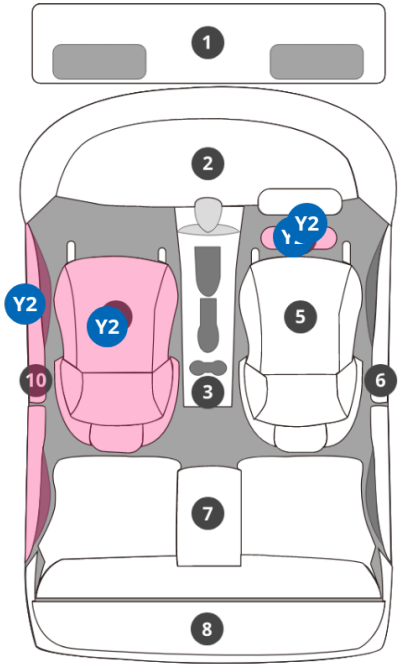
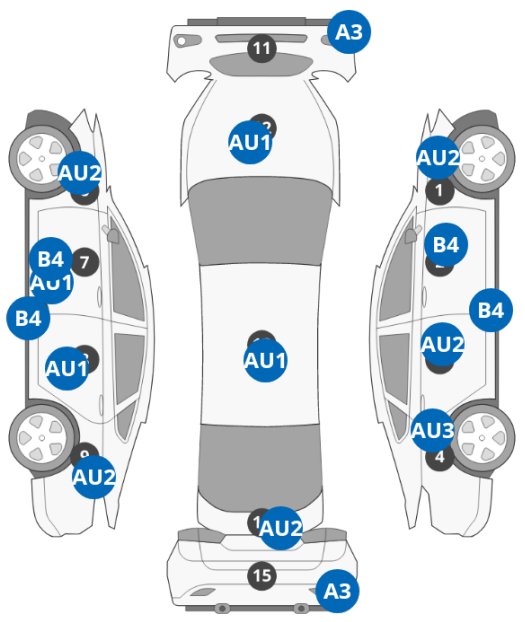
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	119	111	126
2	Boot Lid	123.0	122	122	125
3	Roof	114.7	120	116	107/116
4	Left Front Fender	108.6	107	105	114
5	Left Front Door	114.0	116	112	114
6	Center Panel Left				
7	Left Rear Door	106.0	113	104	101
8	Left Back Panel	113.8	127	115	100
9	Right Front Fender	113.0	114	111	114
10	Right Front Door	117.0	122	118	111
11	Center Panel Right				
12	Right Rear Door	113.3	112	113	115
13	Right Back Panel	118.6	112	114	130

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Modified - Large / Roof - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Modified - Large / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Modified - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Modified - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with spare tire, with warranty and manual booklet, with reverse camera, scratches and dent on exterior, scratches on taillight and headlight, no jack and tools.