

General Information

Date & Time: 15, Jul, 2026 15:28

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	72,572
Registration No.	NKI3302	Chassis No.	PA1B18F32R4262313
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



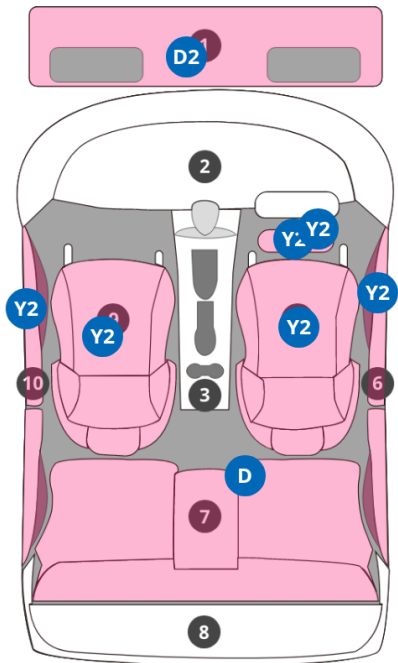
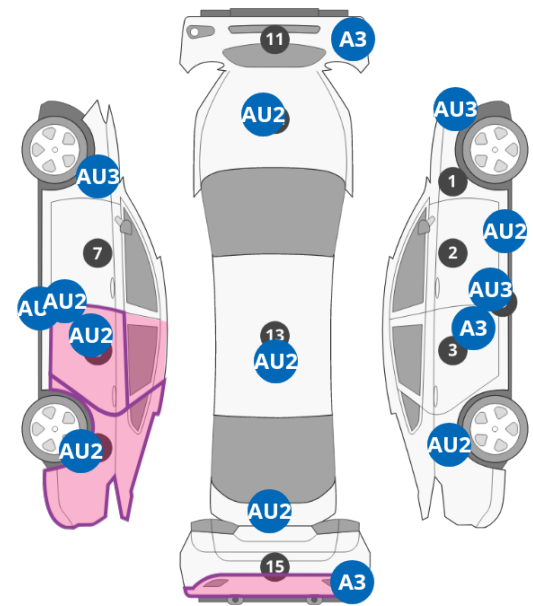
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	105	107	129
2	Boot Lid	129.6	146	120	123
3	Roof	105.6	111	108	104/100
4	Left Front Fender	108.0	109	106	109
5	Left Front Door	107.6	109	111	103
6	Center Panel Left				
7	Left Rear Door	219.3	217	221	220
8	Left Back Panel	125.0	158	109	108
9	Right Front Fender	109.3	113	108	107
10	Right Front Door	107.6	105	110	108
11	Center Panel Right				
12	Right Rear Door	110.0	113	106	111
13	Right Back Panel	101.8	101	99	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Rear Seat - Worn - Yes / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Crinkle - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with spare tire, with manual booklet, with reverse camera, no tools and jack, no spare key, no warranty booklet, no aircon issue, scratches and dent on exterior, scratches on taillight and headlight, issue on plate light, trunk tire cover missing.