

General Information

Date & Time: 20, Jul, 2026 15:32

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	15,849
Registration No.	GBJ2461	Chassis No.	MHFAA1BY8R0035199
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red Mica Metallic		

Body / Panel Condition



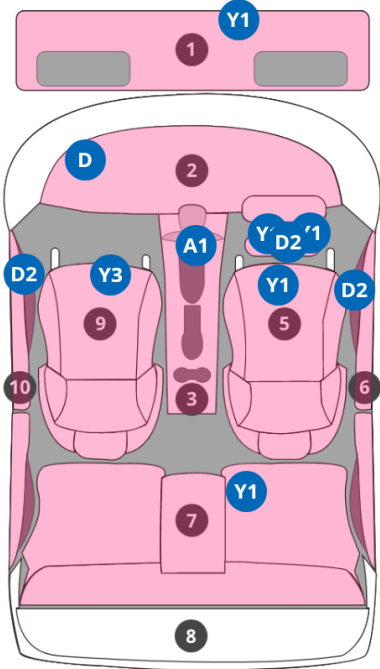
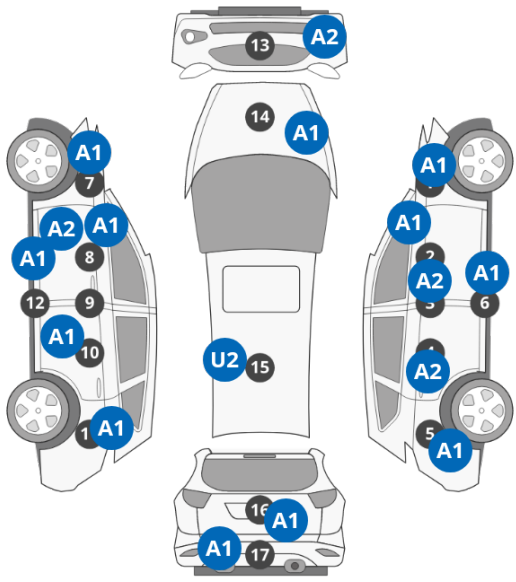
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	109	100	123
2	Boot Lid	115.0	115	113	117
3	Roof	116.0	122	123	106/113
4	Left Front Fender	101.6	102	101	102
5	Left Front Door	115.6	106	116	125
6	Center Panel Left				
7	Left Rear Door	114.0	107	108	127
8	Left Back Panel	126.3	132	104	143
9	Right Front Fender	100.6	102	103	97
10	Right Front Door	113.3	118	116	106
11	Center Panel Right				
12	Right Rear Door	110.3	117	102	112
13	Right Back Panel	114.0	105	109	128

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dash-board - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (L) Front Seat - Grime - Medium / Mat Other - Worked - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / Ceiling - Grime - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch, Peeled - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

with Ito plate/without warranty booklet/with spare tire/with hairlines scratches on the body/with tools and jack/with reverse camera/without spare key/with car seat cover