

General Information

Date & Time: 20, Jul, 2026 09:53

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	12,898
Registration No.	DCD9426	Chassis No.	PA1B18F38S4300939
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



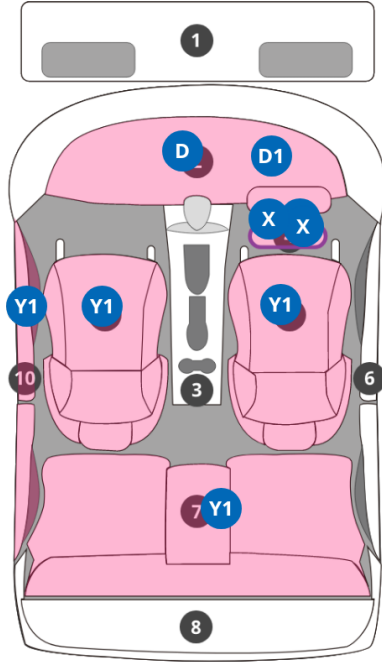
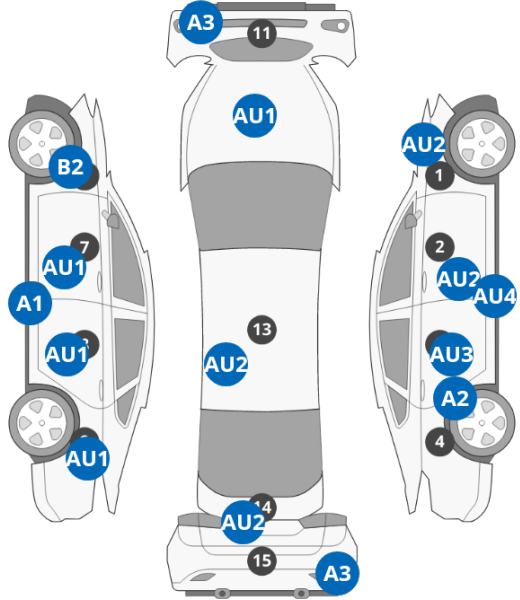
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.3	124	123	123
2	Boot Lid	125.3	120	135	121
3	Roof	122.2	122	125	120/122
4	Left Front Fender	121.0	121	122	120
5	Left Front Door	127.0	137	120	124
6	Center Panel Left				
7	Left Rear Door	121.6	119	122	124
8	Left Back Panel	120.3	121	119	121
9	Right Front Fender	121.6	123	122	120
10	Right Front Door	123.3	122	123	125
11	Center Panel Right				
12	Right Rear Door	125.0	128	128	119
13	Right Back Panel	129.0	140	126	121

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Dashboard - Worked - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Minimal	Remarks Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Modified - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate, with spare tire, with reverse camera, with manual and warranty booklet, with inc tools, no jack, no spare key, scratches and dent on exterior, scratches in taillight and headlight.