

General Information

Date & Time: 15, Jul, 2026 08:16

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	78,383
Registration No.	NHM8256	Chassis No.	MHFAA1BY9R0023174
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



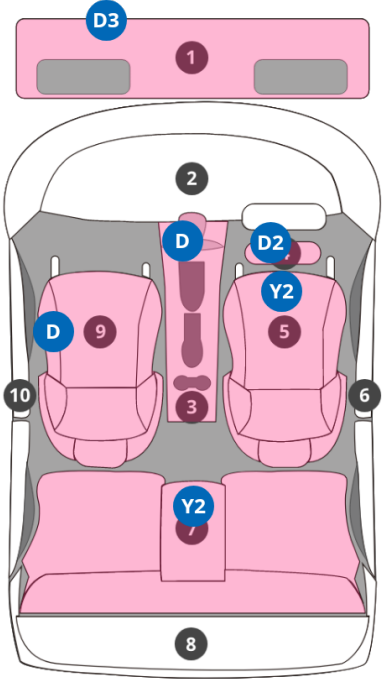
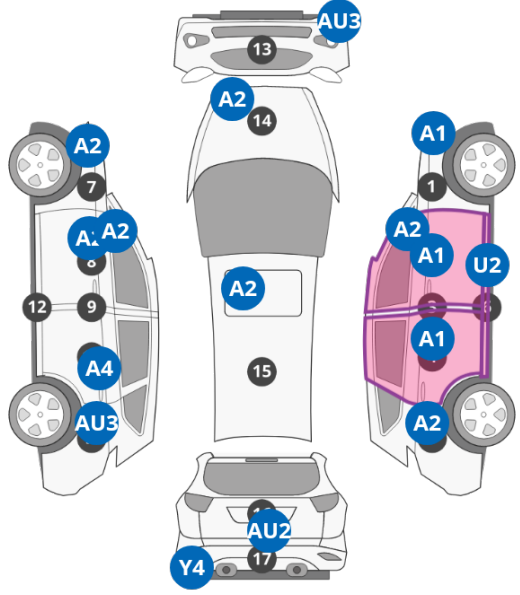
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	113	106	109
2	Boot Lid	110.6	110	104	118
3	Roof	115.7	123	125	103/112
4	Left Front Fender	104.0	106	103	103
5	Left Front Door	122.6	125	122	121
6	Center Panel Left				
7	Left Rear Door	113.6	117	106	118
8	Left Back Panel	115.6	119	118	110
9	Right Front Fender	132.0	146	131	119
10	Right Front Door	149.0	163	151	133
11	Center Panel Right				
12	Right Rear Door	140.0	145	133	142
13	Right Back Panel	150.6	139	143	170

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Console, Switchs, Vents - Traces of Adhesive Tape - Yes / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Crinkle - Medium / Rear Seat - Grime - Small	Remarks (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, plate light issue