

General Information

Date & Time: 14, Jul, 2026 15:55

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	17,803
Registration No.	NJF6383	Chassis No.	PA1B18F32S4284608
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



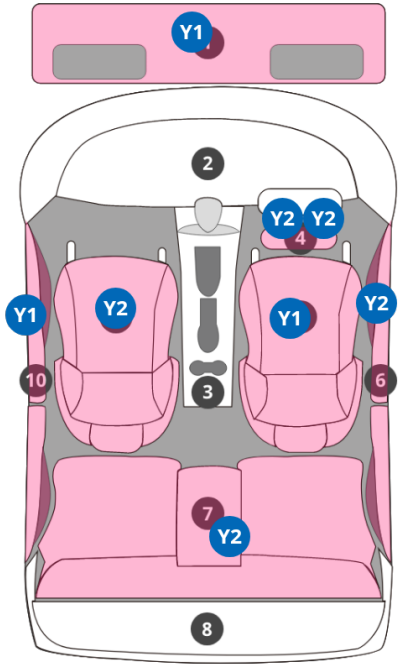
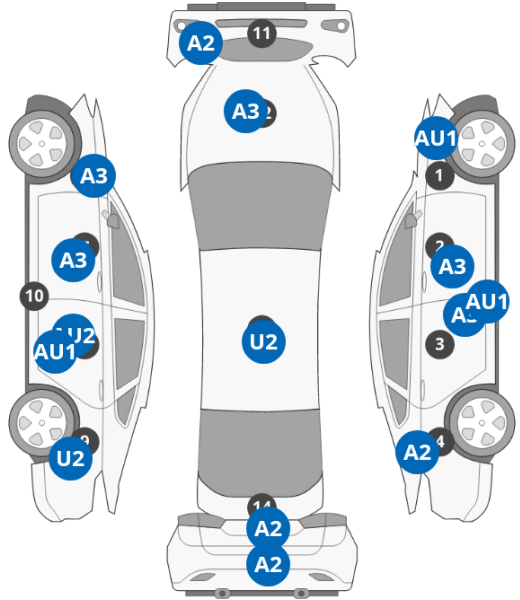
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.0	100	99	110
2	Boot Lid	124.0	123	114	135
3	Roof	100.9	109	92	102/101
4	Left Front Fender	103.6	102	104	105
5	Left Front Door	106.6	106	103	111
6	Center Panel Left				
7	Left Rear Door	113.6	116	117	108
8	Left Back Panel	115.3	120	116	110
9	Right Front Fender	102.6	102	101	105
10	Right Front Door	102.0	105	98	103
11	Center Panel Right				
12	Right Rear Door	110.3	104	109	118
13	Right Back Panel	105.0	106	104	105

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate, with warranty and manual booklet, with spare tire and key, with jack and inc tools, with reverse camera, scratches and dent on exterior, scratches on taillight and headlight.