

General Information

Date & Time: 14, Jul, 2026 10:47

Make	Toyota	Model	Raize
YOM	2024	Odo Meter Reading	13,375
Registration No.	GBE8367	Chassis No.	MHKAB1BA2RJ088735
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



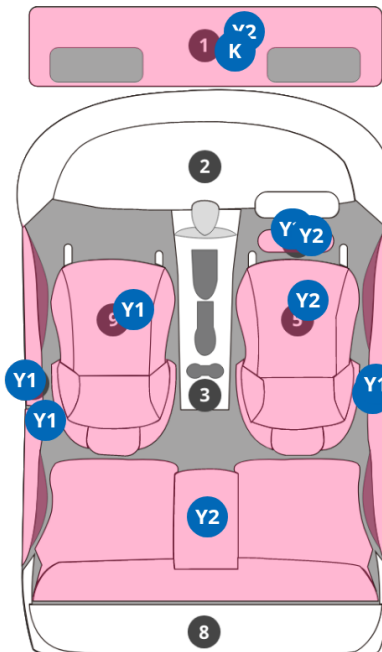
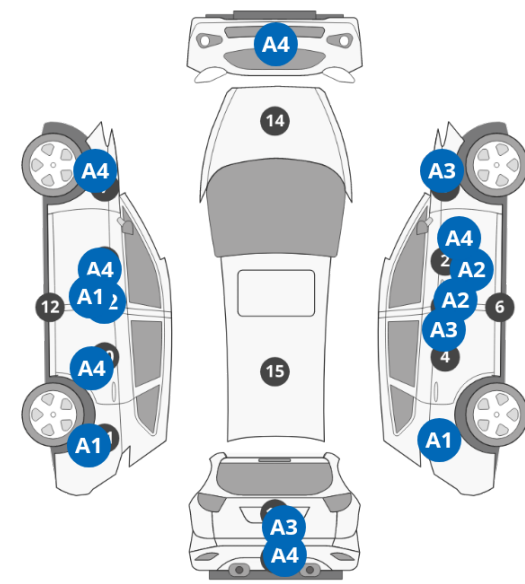
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	116	116	116
2	Boot Lid	96.7	92	107	91
3	Roof	102.3	95	98	110/106
4	Left Front Fender	102.0	100	110	96
5	Left Front Door	112.0	116	109	111
6	Center Panel Left				
7	Left Rear Door	116.6	118	119	113
8	Left Back Panel	98.8	100	95	101
9	Right Front Fender	100.6	105	105	92
10	Right Front Door	104.6	100	110	104
11	Center Panel Right				
12	Right Rear Door	103.6	103	101	107
13	Right Back Panel	93.7	101	90	90

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / Ceiling - Grime - Small / Overall Interior - Animal Hair - Yes / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal	Remarks (L) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

Incomplete tools. Visible hairline scratches. With Warranty booklet, seatcover, sparetire, jack, LTO PLate and 1key.