

General Information

Date & Time: 04, Mar, 2025 15:02

Make	Toyota	Model	Vios
YOM	2024	Mileage	28,143
Registration No.	NIQ5774	Chassis No.	PA1B18F36P4228095
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



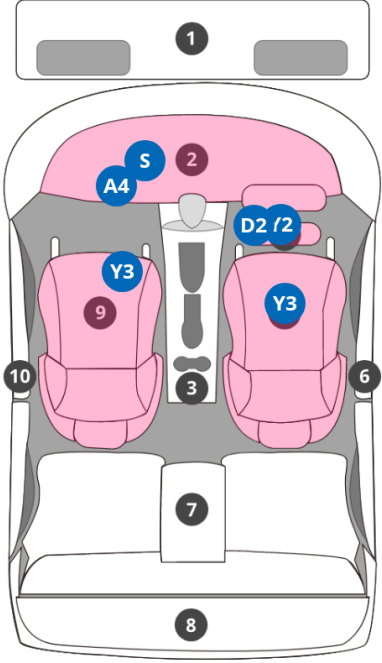
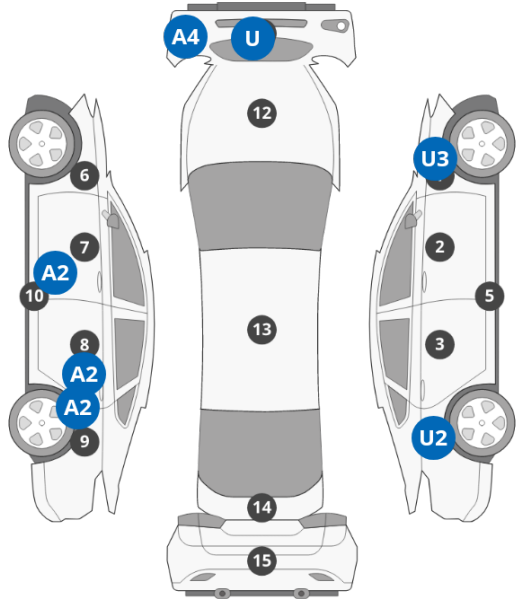
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.7	103	99	112
2	Boot Lid	101.6	97	105	103
3	Roof	111.8	172	93	90/92
4	Left Front Fender	94.1	94	94	95
5	Left Front Door	98.1	98	98	99
6	Center Panel Left				
7	Left Rear Door	96.2	99	94	96
8	Left Back Panel	111.6	116	110	109
9	Right Front Fender	163.0	195	171	123
10	Right Front Door	99.9	107	98	95
11	Center Panel Right				
12	Right Rear Door	111.0	124	104	105
13	Right Back Panel	131.6	133	122	140

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Mat Other - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes / Steering Wheel - Worn, Peel, Crack - Large	Remarks (R) Front Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Dent - Small / (R) Front Fender, Molding - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet, spare tire, jack but incomplete tools. possible flooding and wet booklets. with LTO plate.