

General Information

Date & Time: 14, Jul, 2026 10:49

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	10,844
Registration No.	GBB3019	Chassis No.	MHKAA1BC8SJ044748
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



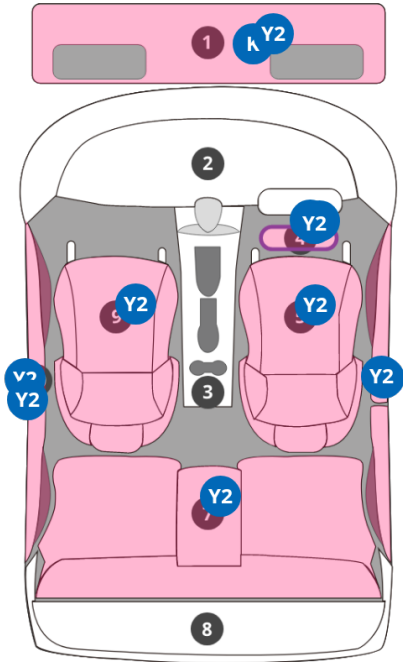
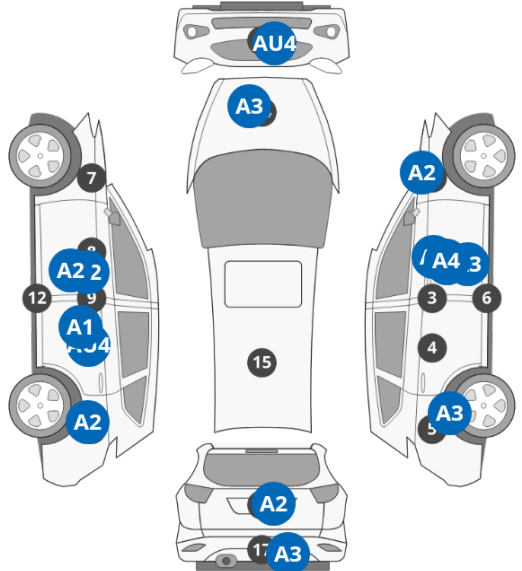
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.3	129	131	134
2	Boot Lid	107.3	109	112	101
3	Roof	97.6	104	87	103/96
4	Left Front Fender	98.5	94	98	104
5	Left Front Door	113.0	102	108	129
6	Center Panel Left				
7	Left Rear Door	114.6	113	119	112
8	Left Back Panel	106.3	107	110	102
9	Right Front Fender	100.2	100	98	103
10	Right Front Door	92.9	93	95	91
11	Center Panel Right				
12	Right Rear Door	105.6	103	101	113
13	Right Back Panel	103.3	103	105	102

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Small	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

Incomplete tools. Gap at front bumper. Visible hairline scratches. adhesive water marks at exterior. Right side side mirror temporary. Without LTO Plate. With warranty booklet, seatcover, sparetire, jack and 1key.