

General Information

Date & Time: 14, Jul, 2026 16:44

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	12,631
Registration No.	GBF2428	Chassis No.	MHKAA1BC0RJ021216
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



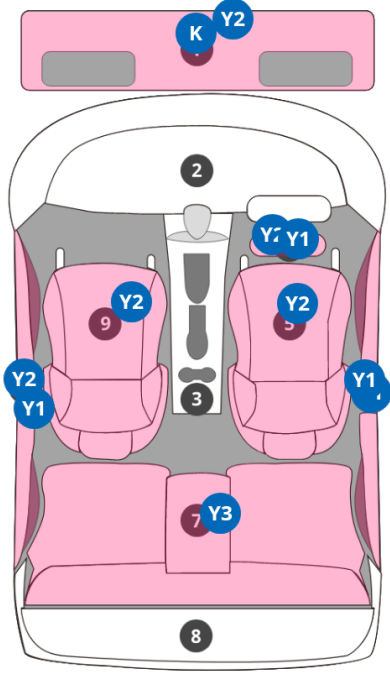
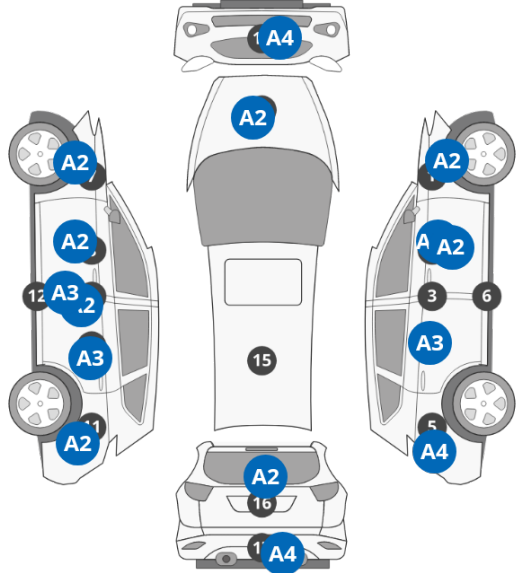
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	132.0	134	134	128
2	Boot Lid	99.3	103	100	95
3	Roof	91.8	95	87	99/86
4	Left Front Fender	109.3	110	115	103
5	Left Front Door	115.0	110	109	126
6	Center Panel Left				
7	Left Rear Door	117.0	128	113	110
8	Left Back Panel	116.0	119	119	110
9	Right Front Fender	97.0	98	98	95
10	Right Front Door	112.3	115	111	111
11	Center Panel Right				
12	Right Rear Door	115.0	105	115	125
13	Right Back Panel	105.0	104	103	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / Mat Other - Grime - Small / (R) Rear Trim - Grime - Minimal / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small	Remarks Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Medium / (L) Front Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
Incomplete tools. Rear right side taillight crack. With warranty booklet, seatcover, sparetire , jack, LTO PLate and 1key.