

General Information

Date & Time: 15, Jul, 2026 07:48

Make	Toyota	Model	Avanza
YOM	2026	Odo Meter Reading	5,073
Registration No.	DCE6026	Chassis No.	MHFAA1BYS0052694
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



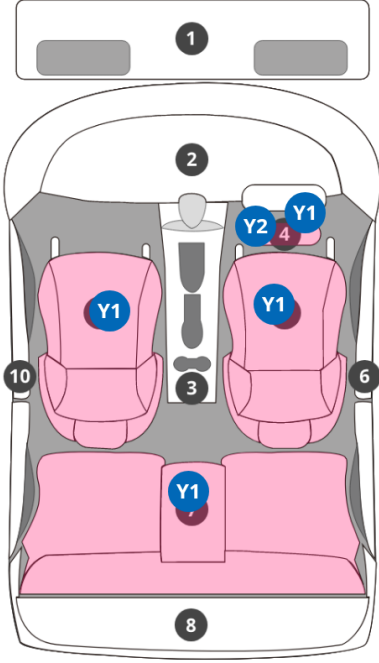
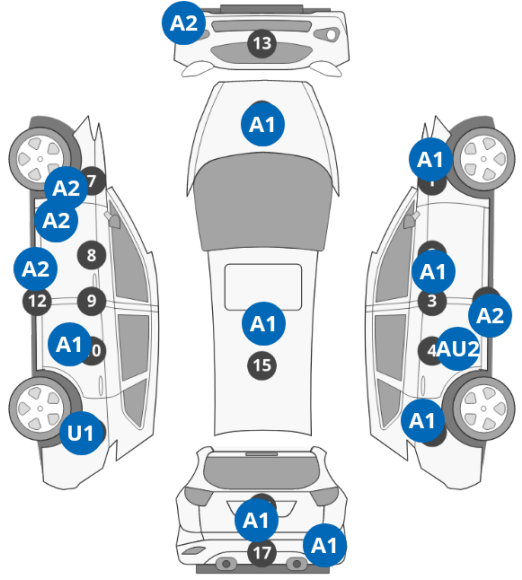
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	112	114	119
2	Boot Lid	110.6	110	118	104
3	Roof	118.5	127	117	114/116
4	Left Front Fender	105.3	106	106	104
5	Left Front Door	123.3	113	122	135
6	Center Panel Left				
7	Left Rear Door	121.6	123	119	123
8	Left Back Panel	116.3	115	123	111
9	Right Front Fender	107.3	110	111	101
10	Right Front Door	113.3	121	113	106
11	Center Panel Right				
12	Right Rear Door	117.0	119	115	117
13	Right Back Panel	114.3	113	110	120

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

no LTO plate/with warranty booklet/with tools and jack/with spare tire/with spare key/with seat cover/minimal scratches on taillight cover/hairline scratches on the body