

General Information

Date & Time: 15, Jul, 2026 15:54

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	40,188
Registration No.	NFR9436	Chassis No.	MHFAA1BY5R0027058
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



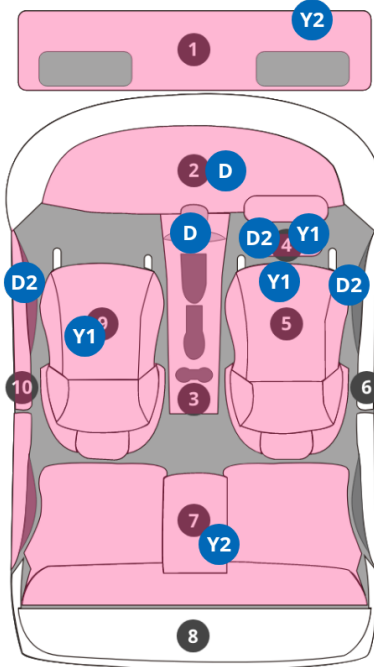
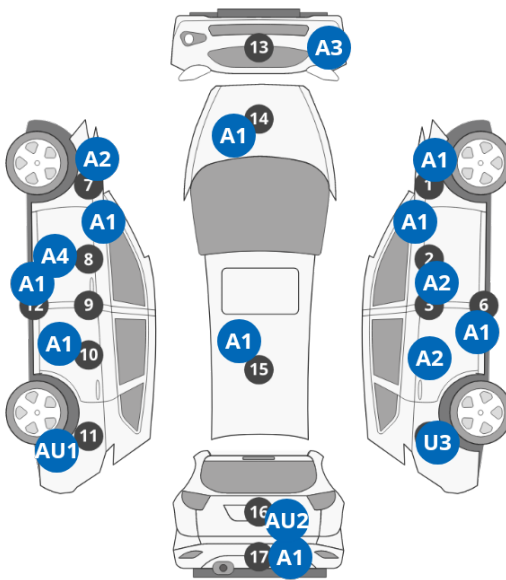
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	122	109	122
2	Boot Lid	110.3	110	111	110
3	Roof	122.7	123	136	116/116
4	Left Front Fender	107.6	108	106	109
5	Left Front Door	128.0	120	127	137
6	Center Panel Left				
7	Left Rear Door	119.6	115	112	132
8	Left Back Panel	128.3	134	128	123
9	Right Front Fender	112.6	120	115	103
10	Right Front Door	123.6	128	125	118
11	Center Panel Right				
12	Right Rear Door	120.0	116	118	126
13	Right Back Panel	121.6	111	123	131

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Minimal / Rear Seat - Grime - Small / Ceiling - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Seat Head Rest - Worked - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with Ito pkate/with warranty booklet/with tools no jack/with hairlines scratches on the body/with reverse camera/with spare tire/without spare key