

General Information

Date & Time: 21, Jul, 2026 08:37

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	35,631
Registration No.	GBE6403	Chassis No.	PA1B18F33P4238325
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



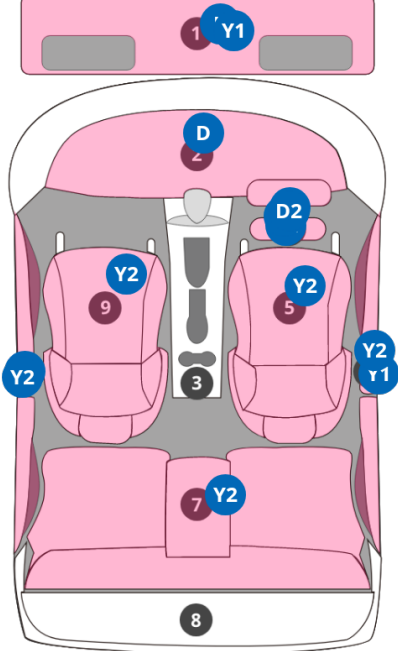
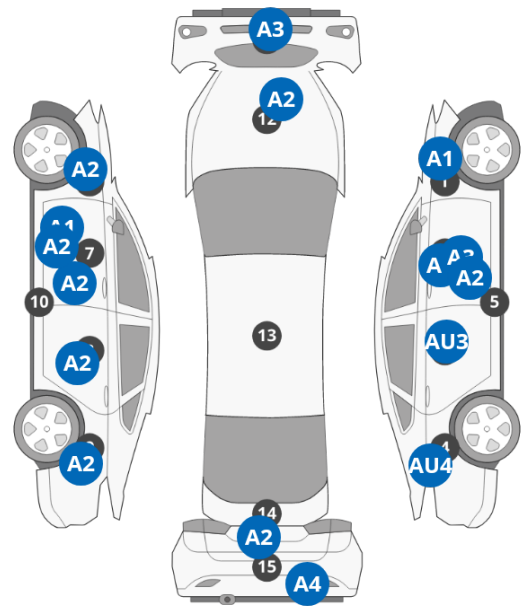
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	129.6	123	122	144
2	Boot Lid	161.3	151	160	173
3	Roof	110.2	112	111	108/110
4	Left Front Fender	111.3	107	111	116
5	Left Front Door	129.6	125	127	137
6	Center Panel Left				
7	Left Rear Door	129.3	139	130	119
8	Left Back Panel	122.6	121	124	123
9	Right Front Fender	114.6	112	117	115
10	Right Front Door	119.0	122	117	118
11	Center Panel Right				
12	Right Rear Door	123.0	119	121	129
13	Right Back Panel	190.6	199	182	191

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / Mat Other - Grime - Small / Rear Seat - Grime - Small / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Rear Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal	Remarks (R) Rear Fender - Repair Traces - Yes / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
No LTO checking status. Punctured front tire. Gap at right rear bumper. With warranty booklet, seatcover, sparetire, jack, tools, LTO plate and 1key.