

General Information

Date & Time: 14, Jul, 2026 16:45

Make	Toyota	Model	Wigo
YOM	2026	Odo Meter Reading	2,744
Registration No.	GBM1203	Chassis No.	MHKAA1BC6SJ046238
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



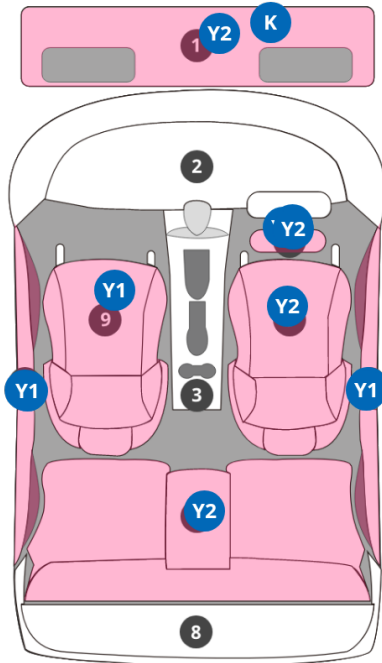
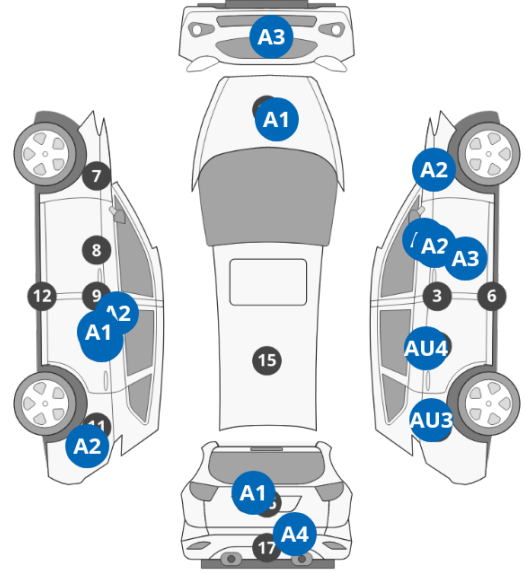
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	142.0	149	136	141
2	Boot Lid	107.6	103	110	110
3	Roof	102.5	106	90	110/104
4	Left Front Fender	113.3	112	115	113
5	Left Front Door	122.3	119	116	132
6	Center Panel Left				
7	Left Rear Door	119.3	128	121	109
8	Left Back Panel	120.6	126	115	121
9	Right Front Fender	113.3	123	116	101
10	Right Front Door	113.0	115	117	107
11	Center Panel Right				
12	Right Rear Door	114.3	103	112	128
13	Right Back Panel	107.0	108	105	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Minimal / Rear Seat - Grime - Small / (R) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Ceiling - Grime - Small / Overall Interior - Animal Hair - Yes / (L) Front Floor Mat - Grime - Small	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

Incomplete tools. Visible hairline scratches. With Warranty booklet, seatcover , sparetire, jack, LTO PLate and 2keys.