

General Information

Date & Time: 20, Jul, 2026 15:33

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	4,691
Registration No.	NJC7173	Chassis No.	MHFAB1BY3S3143179
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Black		

Body / Panel Condition



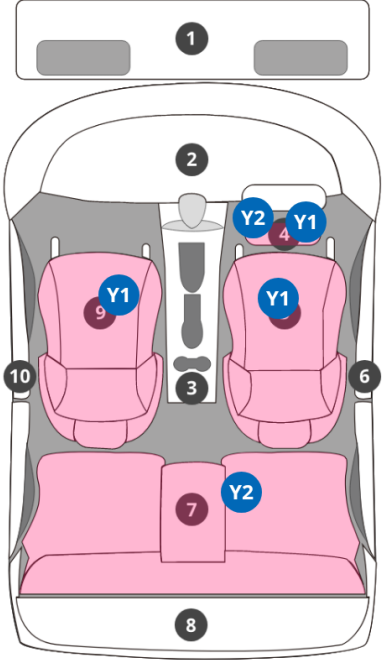
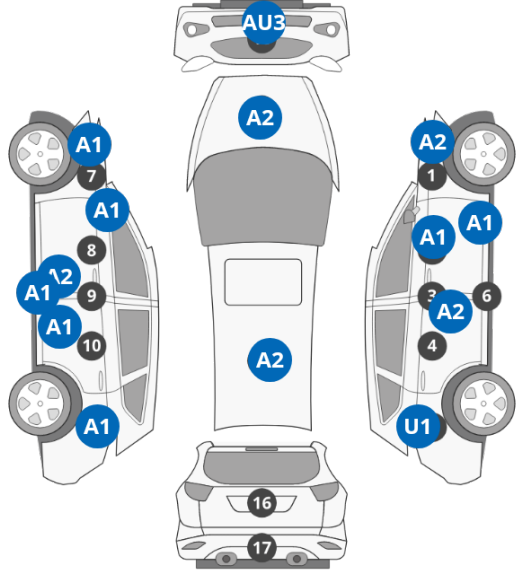
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	105	100	109
2	Boot Lid	107.0	108	113	100
3	Roof	114.2	124	119	108/106
4	Left Front Fender	101.4	106	97	101
5	Left Front Door	118.3	111	117	127
6	Center Panel Left				
7	Left Rear Door	116.3	122	109	118
8	Left Back Panel	114.0	124	115	103
9	Right Front Fender	100.6	103	102	97
10	Right Front Door	117.6	122	115	116
11	Center Panel Right				
12	Right Rear Door	113.6	116	111	114
13	Right Back Panel	113.0	105	110	124

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Small	Remarks (L) Rear Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/with warranty booklet/with incomplete tools no jack/with spare tire/with spare key/with seat cover/hairline scratches on the body