


General Information

Date & Time: 20, Jul, 2026 10:32

Make	Toyota	Model	Corolla Cross
YOM	2025	Odo Meter Reading	25,009
Registration No.	DNW3925	Chassis No.	MR2KZAAG0R0097111
CC	1.8	Transmission	HEV CVT
Fuel Type	Hybrid	Type of Body	Wagon
Colour	White		

Body / Panel Condition

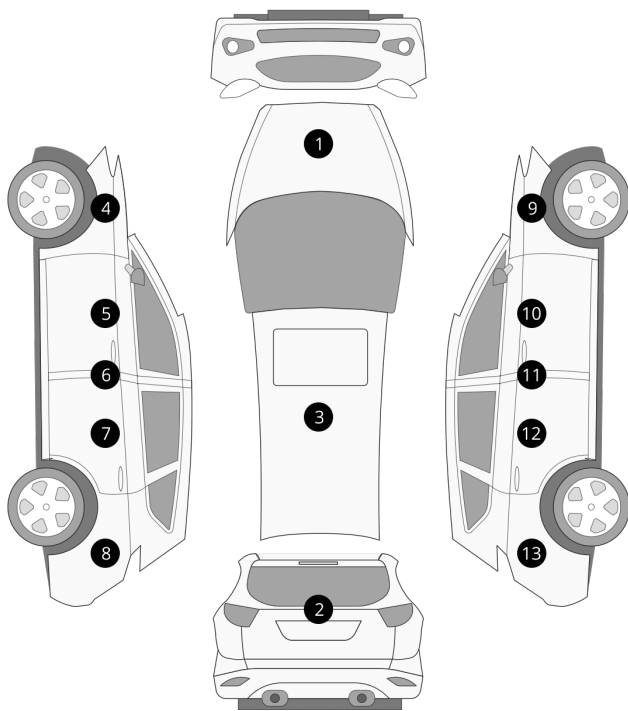

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.6	141	109	142
2	Boot Lid	113.0	108	109	122
3	Roof	138.7	148	149	136/122
4	Left Front Fender	123.0	137	118	114
5	Left Front Door	123.0	121	118	130
6	Center Panel Left				
7	Left Rear Door	124.0	119	127	126
8	Left Back Panel	126.3	140	117	122
9	Right Front Fender	120.6	110	118	134
10	Right Front Door	119.0	114	124	119
11	Center Panel Right				
12	Right Rear Door	122.6	115	122	131
13	Right Back Panel	133.6	144	122	135

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worn, Scratch, Cut, Crack - Minimal / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / Mat Other - Grime - Minimal / Rear Seat - Grime - Large / Ceiling - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with lto plate/with warranty booklet/with spare tire/with reverse camera/with dash camera/without spare key/withoout tools and jack/with hairlines scratches and dent on the body