

General Information

Date & Time: 15, Jul, 2026 15:55

Make	Toyota	Model	Fortuner
YOM	2025	Odo Meter Reading	17,726
Registration No.	NFN6996	Chassis No.	MHFCB3GS2R0497568
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	White		

Body / Panel Condition



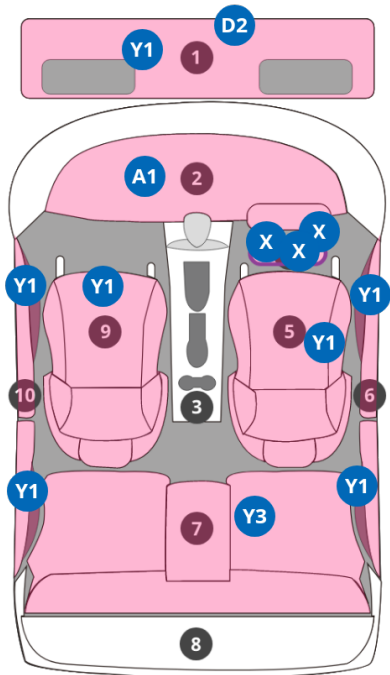
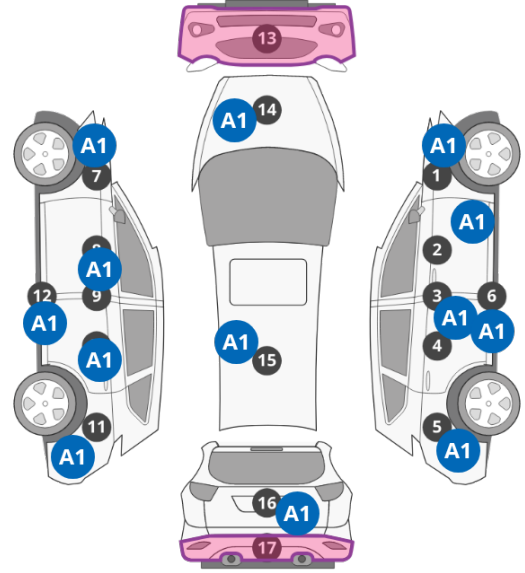
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.9	109	120	80
2	Boot Lid	98.8	95	110	91
3	Roof	103.9	102	121	96/97
4	Left Front Fender	107.3	111	111	100
5	Left Front Door	105.6	110	107	100
6	Center Panel Left				
7	Left Rear Door	103.9	109	106	97
8	Left Back Panel	108.0	106	112	106
9	Right Front Fender	103.6	108	102	101
10	Right Front Door	98.4	93	99	103
11	Center Panel Right				
12	Right Rear Door	96.9	101	97	93
13	Right Back Panel	109.2	108	100	120

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Dashboard - Worn, Scratch, Cut, Crack - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Medium / Sunvisor, Sunglass Holder - Loose, Deformed - Small / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (R) Rear Trim - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/without warranty booklet/with spare tire/with tools and jack/with reverse camera/with hairlines scratches on the body/without spare key/ceiling dome light issue