

General Information

Date & Time: 15, Jul, 2026 07:45

Make	Toyota	Model	Hiace
YOM	2025	Odo Meter Reading	19,863
Registration No.	NKN6562	Chassis No.	JTFJT02P3S5039670
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



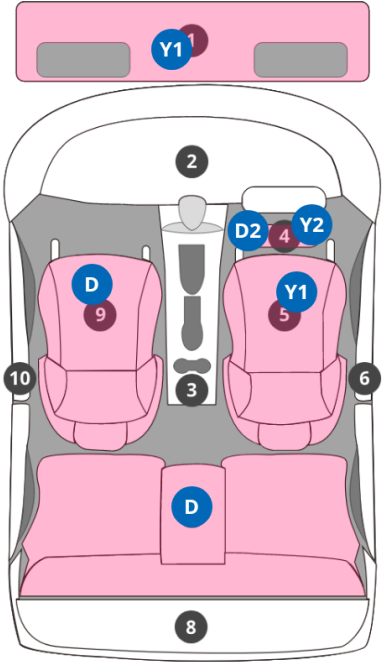
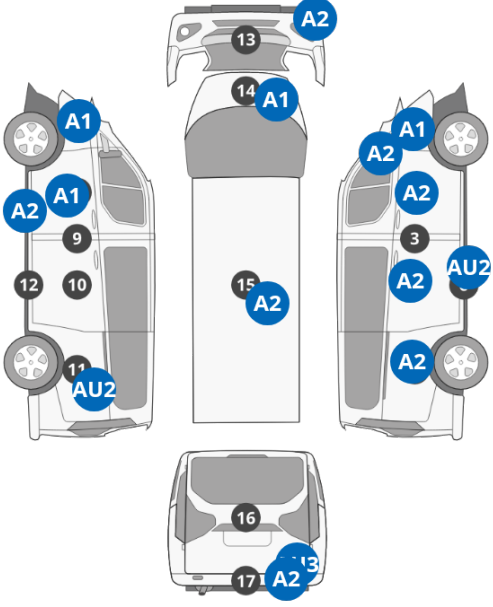
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	108	126	122
2	Boot Lid	109.6	108	112	109
3	Roof	108.5	111	94	117/112
4	Left Front Fender	131.3	140	133	121
5	Left Front Door	113.6	106	112	123
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	115.3	111	112	123
9	Right Front Fender	118.0	117	121	116
10	Right Front Door	115.0	116	114	115
11	Center Panel Right	131.0	140	130	123
12	Right Rear Door	113.0	116	109	114
13	Right Back Panel	121.0	134	116	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / Rear Seat - Worn - Yes / (R) Front Seat - Grime - Minimal / (L) Front Seat - Worn - Yes	Remarks Front Panel - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/no spare key/rear seats not installed/hairline scratches on the body