

General Information

Date & Time: 14, Jul, 2026 15:49

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	34,220
Registration No.	EAG4902	Chassis No.	PA1B18F32P4218132
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



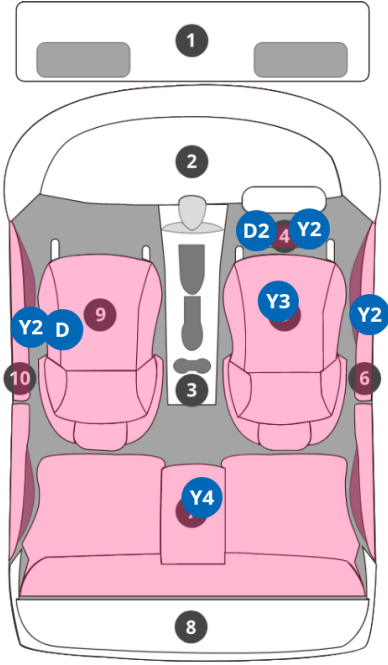
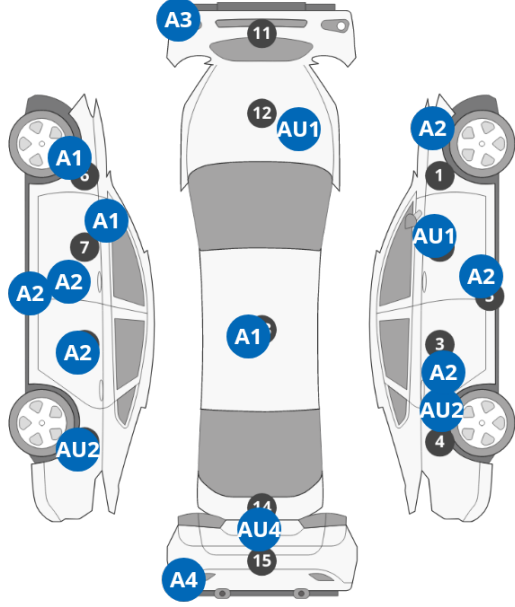
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.7	104	113	97
2	Boot Lid	122.0	109	115	142
3	Roof	100.5	103	98	102/99
4	Left Front Fender	108.0	117	103	104
5	Left Front Door	106.0	109	104	105
6	Center Panel Left				
7	Left Rear Door	108.0	109	103	112
8	Left Back Panel	115.0	123	112	110
9	Right Front Fender	99.1	101	96	100
10	Right Front Door	106.6	109	103	108
11	Center Panel Right				
12	Right Rear Door	108.3	105	108	112
13	Right Back Panel	115.0	111	109	125

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with warranty booklet/no tools and jack/with spare tire/with spare key/no reverse camera/tailight cover cracked/hairline scratches on the body