

General Information

Date & Time: 22, Jul, 2026 07:35

Make	Toyota	Model	Hiace
YOM	2024	Odo Meter Reading	30,952
Registration No.	NKD3043	Chassis No.	JTFJT02P9R0018300
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



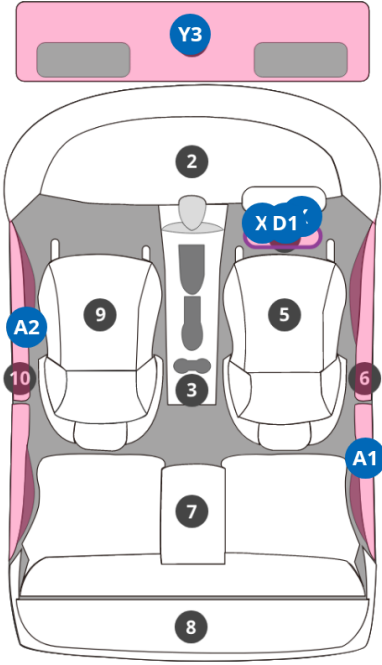
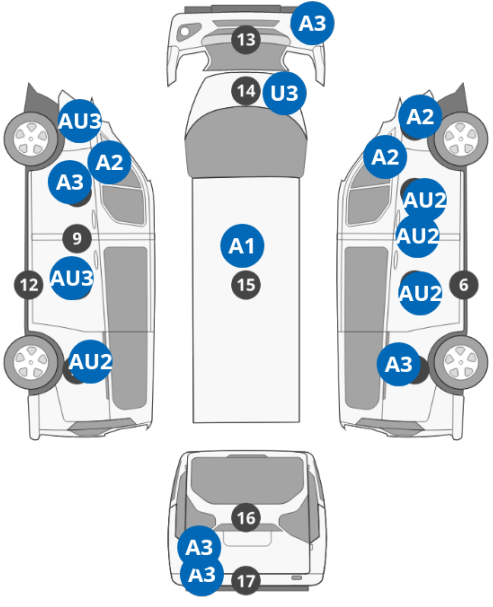
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.4	100	102	99
2	Boot Lid	108.6	108	119	99
3	Roof	95.0	95	95	79/111
4	Left Front Fender	105.0	107	107	101
5	Left Front Door	102.3	100	107	100
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	112.0	136	100	100
9	Right Front Fender	102.8	106	103	100
10	Right Front Door	88.3	87	92	86
11	Center Panel Right	100.4	106	100	96
12	Right Rear Door	99.5	97	100	102
13	Right Back Panel	102.0	103	100	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Carpet - Worked - Minimal / (L) Front Trim - Cut, Crack - Small	Remarks (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Center Panel - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Front Panel - Dent - Medium / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, plate light issue