

General Information

Date & Time: 15, Jul, 2026 08:14

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	32,273
Registration No.	DCA6094	Chassis No.	MHKAA1BCXSJ042144
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



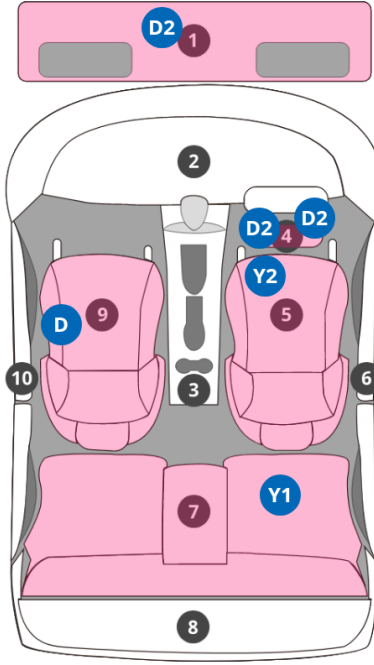
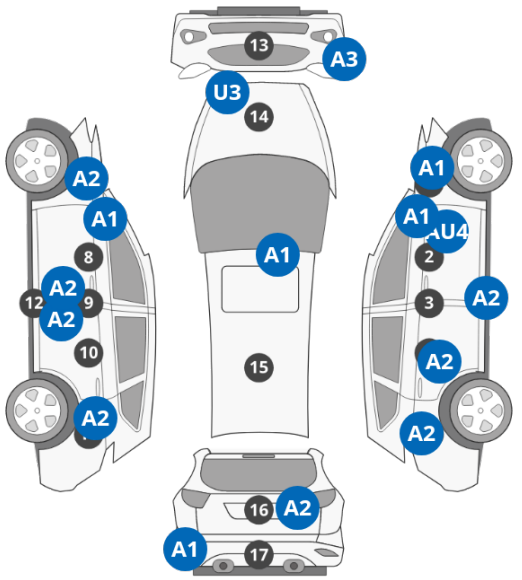
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	112	114	109
2	Boot Lid	105.0	107	106	102
3	Roof	109.0	107	111	108/110
4	Left Front Fender	107.0	107	109	105
5	Left Front Door	108.3	106	111	108
6	Center Panel Left				
7	Left Rear Door	105.3	106	108	102
8	Left Back Panel	105.6	104	108	105
9	Right Front Fender	105.3	107	103	106
10	Right Front Door	105.3	108	104	104
11	Center Panel Right				
12	Right Rear Door	107.6	111	110	102
13	Right Back Panel	105.0	106	106	103

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B		Exterior Evaluation : D	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / Rear Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Ceiling - Crinkle - Small		Remarks (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Minimal / Bonnet, Headlight - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Spare Key - Issue - Unexist	

Inspector Notes

with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light